



Australian Notices to Mariners are the authority for correcting Australian Charts and Publications

AUSTRALIAN NOTICES TO MARINERS

Notices 27 - 111

List of Temporary and Preliminary Notices in force

Published fortnightly by the Australian Hydrographic Service

Commodore B.K. BRACE RAN
Hydrographer of Australia

SECTIONS.

- I. Australian Notices to Mariners, including blocks and notes.
- II. Hydrographic Reports.
- III. Navigational Warnings.

SUPPLEMENTS.

- I. Tracings
- II. Cumulative List of Australian Notices to Mariners.
- III. Cumulative List of Temporary and Preliminary Australian Notices to Mariners.
- IV. Temporary and Preliminary Notices in force.
- V. Amendments to Admiralty List of Lights and Fog Signals (Vol K), Radio Signals (NP 281(2), 282, 283(2), 285, 286(4)) and Sailing Directions (NP 9, 13, 14, 15, 33, 34, 35, 36, 39, 44, 51, 60, 61, 62, 100, 136).

© Commonwealth of Australia 2016

This work is copyright. Apart from any use permitted under the Copyright Act 1968, no part may be reproduced by any process, adapted, communicated or commercially exploited without prior written permission from The Commonwealth represented by the Australian Hydrographic Service.

IMPORTANT NOTICE

This edition of Notices to Mariners includes all significant information affecting AHS products which the AHS has become aware of since the last edition. All reasonable efforts have been made to ensure the accuracy and completeness of the information, including third party information, on which these updates are based. The AHS regards third parties from which it receives information as reliable, however the AHS cannot verify all such information and errors may therefore exist. The AHS does not accept liability for errors in third party information.

GENERAL INSTRUCTIONS

The substance of these notices should be inserted on the charts affected.

Bearings are referred to the true compass and are reckoned clockwise from North; those relating to lights are given as seen by an observer from seaward.

Positions quoted in notices relate to WGS84 which is the horizontal datum for all charts produced by the Australian Hydrographic Service.

The range quoted for a light is its nominal range.

Depths are with reference to the chart datum of each chart. Heights are above mean high water springs or mean higher high water, as appropriate.

The capital letter (P) or (T) after the number of any notice denotes a preliminary or temporary notice respectively, which are contained separately at the end of the permanent notices.

A star (*) adjacent to the number of a notice indicates that the notice is based on original information.

REPORTING OF DANGERS

Mariners are particularly requested to notify the AUSTRALIAN HYDROGRAPHIC SERVICE, Locked Bag 8801 Wollongong, NSW 2500 (Fax 02-4223 6599, e-mail datacentre@hydro.gov.au or, alternatively by filling in and submitting the [Hydrographic Notes](#) forms located on the web site – www.hydro.gov.au), immediately on the discovery of new dangers or suspected dangers to navigation. For changes or defects in aids to navigation notify AusSAR (Fax 02-6230 6868 or email rccaus@amsa.gov.au).

AUTHORISED USE

Copies of Australian notices are available free of charge from the Australian Hydrographic Service (AHS) website (www.hydro.gov.au) and through the eNotices (email) service (www.hydro.gov.au/enotices/enotices.htm).

Individual Notices may be copied for the purpose of inserting Notice substance on official charts and publications. Paper copies may be printed by chart agents and distributed to customers on a cost recovery basis. Participating chart agents are listed on the AHS website as providing a 'Paper Notices to Mariners' service (www.hydro.gov.au/prodserv/distributors/distributors.htm). Copies of the notices may not be sold for profit without prior written agreement.

NUMERICAL INDEX OF NOTICES TO MARINERS

Edition No 1

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
27	Aus 5000, 5001
28	Cessation of dredged depth updates
29	Amendment to Australian National Tide Tables 2016
30	Amendment to Australian Notice to Mariners No 2
31	Aus 246
32	Aus 246
33	Aus 235, 236, 814, 815
34	Aus 258
35	Aus 236
36	Aus 522
37	Aus 399, 683, 4622, INT 622
38	Aus 545, 546
39	Aus 628
40	Aus 379, 505, 621
41	Aus 293, 299, 700
42	Aus 24
43	Aus 58
44	Aus 328
45	Aus 64
46	Aus 143, 157
47	Aus 154
48	Aus 143, 788
49(T)	Aus 196, 198, 199
50(T)	Aus 197, 200, 201, AX 00200T, 00201T
51(T)	Aus 197, 200, 201, AX 00201T, 63200
52(T)	Aus 197, 200, 808, 809, AX 00200T, 00808S, 00809S
53(T)	Aus 197, 200, 808, 809, AX 00808S, 00809S, 63200
54(T)	Aus 207, 208, 809, AX 00809S
55(T)	Aus 200, 202, AX 00202T
56(T)	Aus 200, 201, AX 00200T, 00201T
57(T)	Aus 200, 202, AX 00202T
58(T)	Aus 209
59(T)	Aus 489, 809, 810, 811, 4643, INT 643, AX 00809S
60(T)	Aus 268
61(T)	Aus 262, 263, 264, 830, AX 00262T, AXA 0830T
62(T)	Aus 246
63(T)	Aus 230, 814
64(T)	Aus 241, 817
65(T)	Aus 249, 250, 823, AX 00249S, 00823S
66(T)	Aus 6
67(T)	Aus 6
68(T)	Aus 6, 303
69(T)	Aus 252, 254
70(T)	Aus 250
71(T)	Aus 235, 236
72(T)	Aus 252, 253
73(T)	Aus 256, 827
74(T)	Aus 256, 257, 827
75(T)	Aus 256, 257, 827
76(T)	Aus 256, 257
77(T)	Aus 814
78(T)	Aus 399, 683, 4622, INT 622
79(T)	Aus 520, 4620, 4621, INT 620, 621, AX 04620U, 04621S, 04621U
80(T)	Aus 673
81(T)	Aus 515, 516, 637, 4621, INT 621, AX 04621S, 04621U
82(T)	Aus 506, 4604, 4620, 4621, INT 604, 620, 621, AX 04604U, 04620U, 04621S, 04621U
83(T)	Aus 376, 377, 378, 379, 502, 505, 506, 507, 508, 621, 623, 647, 840, 4603, 4604, 4620, 4621, 4622, INT 603, 604, 620, 621, 622, AX 04603U, 04604U, 04620U, 04621S, 04621U
84(T)	Aus 839
85(T)	Aus 293, 299
86(T)	Aus 24, 26, 28, AX 00026T
87(T)	Aus 64, 69, 743
88(T)	Aus 64, 69, 743
89(T)	Aus 328, 742, 4723, INT 723, AX 04723U
90(T)	Aus 62, 66

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
91(T)	Aus 325, 326, 4722, INT 722, AX 04722U
92(T)	Aus 319, 320, 4721, 4722, INT 721, 722, AX 00319U, 04721U, 04722U
93(T)	Aus 319, 320, 322, AX 00319S, 00319U, 00320S, 00322U
94(T)	Aus 327, 4723, INT 723, AX 04723U
95(T)	Aus 327, 4722, 4723, INT 722, 723, AX 04722U, 04723U
96(T)	Aus 328
97(T)	Aus 327, 328
98(T)	Aus 328, 4723, INT 723, AX 04723U
99(T)	Aus 327, 328
100(T)	Aus 328, 329, 744
101(T)	Aus 328, 329, 744, 4723, 4725, INT 723, 725, AX 04723U
102(T)	Aus 57, 741, 742
103(T)	Aus 326, 4722, 4723, INT 722, 723, AX 04722U, 04723U
104(T)	Aus 328
105(T)	Aus 127, 347
106(T)	Aus 132
107(T)	Aus 122
108(T)	Aus 158
109(T)	Aus 154, 155
110(T)	Aus 169, 766, AX 00766S
111(T)	TEMPORARY AND PRELIMINARY NOTICES

NUMERICAL INDEX OF CHARTS AFFECTED

Edition No 1

Aus Chart	Notices
Aus 6	66(T), 67(T), 68(T)
Aus 24	42, 86(T)
Aus 26	86(T)
Aus 28	86(T)
Aus 57	102(T)
Aus 58	43
Aus 62	90(T)
Aus 64	45, 87(T), 88(T)
Aus 66	90(T)
Aus 69	87(T), 88(T)
Aus 122	107(T)
Aus 127	105(T)
Aus 132	106(T)
Aus 143	46, 48
Aus 154	47, 109(T)
Aus 155	109(T)
Aus 157	46
Aus 158	108(T)
Aus 169	110(T)
Aus 196	49(T)
Aus 197	50(T), 51(T), 52(T), 53(T)
Aus 198	49(T)
Aus 199	49(T)
Aus 200	50(T), 51(T), 52(T), 53(T), 55(T), 56(T), 57(T)
Aus 201	50(T), 51(T), 56(T)
Aus 202	55(T), 57(T)
Aus 207	54(T)
Aus 208	54(T)
Aus 209	58(T)
Aus 230	63(T)
Aus 235	33, 71(T)
Aus 236	33, 35, 71(T)
Aus 241	64(T)
Aus 246	31, 32, 62(T)
Aus 249	65(T)
Aus 250	65(T), 70(T)
Aus 252	69(T), 72(T)
Aus 253	72(T)
Aus 254	69(T)
Aus 256	73(T), 74(T), 75(T), 76(T)
Aus 257	74(T), 75(T), 76(T)
Aus 258	34
Aus 262	61(T)
Aus 263	61(T)
Aus 264	61(T)
Aus 268	60(T)
Aus 293	41, 85(T)
Aus 299	41, 85(T)
Aus 303	68(T)
Aus 319	92(T), 93(T)
Aus 320	92(T), 93(T)
Aus 322	93(T)
Aus 325	91(T)
Aus 326	91(T), 103(T)

Aus Chart	Notices
Aus 327	94(T), 95(T), 97(T), 99(T)
Aus 328	44, 89(T), 96(T), 97(T), 98(T), 99(T), 100(T), 101(T), 104(T)
Aus 329	100(T), 101(T)
Aus 347	105(T)
Aus 376	83(T)
Aus 377	83(T)
Aus 378	83(T)
Aus 379	40, 83(T)
Aus 399	37, 78(T)
Aus 489	59(T)
Aus 502	83(T)
Aus 505	40, 83(T)
Aus 506	82(T), 83(T)
Aus 507	83(T)
Aus 508	83(T)
Aus 515	81(T)
Aus 516	81(T)
Aus 520	79(T)
Aus 522	36
Aus 545	38
Aus 546	38
Aus 621	40, 83(T)
Aus 623	83(T)
Aus 628	39
Aus 637	81(T)
Aus 647	83(T)
Aus 673	80(T)
Aus 683	37, 78(T)
Aus 700	41
Aus 741	102(T)
Aus 742	89(T), 102(T)
Aus 743	87(T), 88(T)
Aus 744	100(T), 101(T)
Aus 766	110(T)
Aus 788	48
Aus 808	52(T), 53(T)
Aus 809	52(T), 53(T), 54(T), 59(T)
Aus 810	59(T)
Aus 811	59(T)
Aus 814	33, 63(T), 77(T)
Aus 815	33
Aus 817	64(T)
Aus 823	65(T)
Aus 827	73(T), 74(T), 75(T)
Aus 830	61(T)
Aus 839	84(T)
Aus 840	83(T)
Aus 4603	83(T)
Aus 4604	82(T), 83(T)
Aus 4620	79(T), 82(T), 83(T)
Aus 4621	79(T), 81(T), 82(T), 83(T)
Aus 4622	37, 78(T), 83(T)
Aus 4643	59(T)
Aus 4721	92(T)

Aus Chart	Notices
Aus 4722	91(T), 92(T), 95(T), 103(T)
Aus 4723	89(T), 94(T), 95(T), 98(T), 101(T), 103(T)
Aus 4725	101(T)
Aus 5000	27
Aus 5001	27
AX 00026T	86(T)
AX 00200T	50(T), 52(T), 56(T)
AX 00201T	50(T), 51(T), 56(T)
AX 00202T	55(T), 57(T)
AX 00249S	65(T)
AX 00262T	61(T)
AX 00319S	93(T)
AX 00319U	92(T), 93(T)
AX 00320S	93(T)
AX 00322U	93(T)
AX 00766S	110(T)
AX 00808S	52(T), 53(T)
AX 00809S	52(T), 53(T), 54(T), 59(T)
AX 00823S	65(T)
AX 04603U	83(T)
AX 04604U	82(T), 83(T)
AX 04620U	79(T), 82(T), 83(T)
AX 04621S	79(T), 81(T), 82(T), 83(T)
AX 04621U	79(T), 81(T), 82(T), 83(T)
AX 04721U	92(T)
AX 04722U	91(T), 92(T), 95(T), 103(T)
AX 04723U	89(T), 94(T), 95(T), 98(T), 101(T), 103(T)
AX 63200	51(T), 53(T)
AXA 0830T	61(T)

INT Chart	Notices
INT 603	83(T)
INT 604	82(T), 83(T)
INT 620	79(T), 82(T), 83(T)
INT 621	79(T), 81(T), 82(T), 83(T)
INT 622	37, 78(T), 83(T)
INT 643	59(T)
INT 721	92(T)
INT 722	91(T), 92(T), 95(T), 103(T)
INT 723	89(T), 94(T), 95(T), 98(T), 101(T), 103(T)
INT 725	101(T)

27 AUSTRALIA - Products - New Charts, New Editions, Withdrawn Charts

Australian Hydrographic Service (AA853862)

New Charts

<i>Chart</i>	<i>Title and Geographical limits</i>	<i>Scale</i>	<i>Publication Date</i>	<i>Remarks</i>
NIL				

New Electronic Navigation Chart (Aus ENC)

<i>Cell Name</i>	<i>Title</i>	<i>Publication Date</i>	<i>Remarks</i>
NIL			

New Editions and Withdrawn Charts

<i>Chart</i>	<i>Title</i>	<i>Scale</i>	<i>Publication Date</i>	<i>Remarks</i>
Aus 5000	Australian Index of Nautical Charts - Northern Portion 2016		15 January 2016	Aus 5000 2015 withdrawn
Aus 5001	Australian Index of Nautical Charts - Southern Portion 2016		15 January 2016	Aus 5001 2015 withdrawn

Chart permanently withdrawn

Charts listed above as withdrawn no longer meet chart carriage requirements and should be marked as "superseded" and replaced with the new chart/ new edition listed prior to passage through the area covered by the new chart.

When placing orders with a chart agent between notice of forthcoming edition and its publication, mariners should advise whether their order pertains to the current edition or the new edition.

For further details refer to the AHS website at www.hydro.gov.au for new edition and new chart stock arrival information.

When placing orders with a chart agent, mariners should advise whether their order pertains to the current edition or the new edition.

28 Cessation of dredged depth updates

Australian Hydrographic Service (AA350099)

The Australian Hydrographic Service will no longer publish temporary depth information for maintained dredged channels and berth pockets. Paper charts and ENC will reflect the intended design depth. For the latest depth information contact the relevant Port Authority.

29 AUSTRALIA - Product - Amendment to Australian National Tide Tables 2016

Australian Hydrographic Service (AA853014, AA853015)

Page xxxi
Amend Dampier To Chart Datum AUS 59 NE 23 OCT 2015 0.0

Page xxxiii
Amend Gladstone To Chart Datum AUS 246 NC 18 DEC 2015 0.0

Page xxxv
Insert Onslow To Chart Datum AUS69 NC 18 DEC 2015 0.0

Page 404
Amend To Chart Datum correction for Ashburton North (Port No 62467) to 0.0

30 AUSTRALIA - Product - Amendment to Australian Notice to Mariners No 2

Australian Hydrographic Service (AA853109)

Page 14

Amend DPM (Singapore) Pte Ltd details to read:

GNS Singapore	Telephone	(65) 6270 4060	C,NtM
2 Boon Leat Terrance	Fax	(65) 6276 3858	
#05-02/02/04 Harbourside Building 2	Email	sg.info@gnsworldwide.com	
Singapore 119844	Website	www.gnsworldside.com	

Insert new chart agent:

GNS UK	Telephone	+44 (0) 191 257 2217	N
17 Elm Road	Email	uk.info@gnsworldwide.com	
North Shields	Website	www.gnsworldside.com	
Tyne & Wear NE29 8SE			

31* AUSTRALIA - QUEENSLAND - Gladstone - Erroneous text

UKHO (SIRF2015002466)

Aus 246 [NC 18/12/2015]

Delete	text, 8	23° 55'.57 S	151° 35'.92 E
	text, 6	23° 57'.32 S	151° 25'.00 E

32* AUSTRALIA - QUEENSLAND - Gladstone - South Channel - Light buoy

Maritime Safety Queensland Notice 372/2015 (SIRF2016002568)

Aus 246 [31/2016]

Move	light buoy	23° 53'.68 S	151° 30'.09 E
	to	23° 53'.751 S	151° 30'.101 E

33* AUSTRALIA - QUEENSLAND - Moreton Bay - Spitfire Channel - Light beacons*Former Notice* - 1025(T)/2014 is cancelled

Maritime Safety Queensland Notices 374/2015, 375(T)/2015 (SIRF2016002566, SIRF2016002567)

Aus 235 [917/2015]

Insert	light beacon, Q.G M1, without topmark	27° 03'.47 S	153° 17'.88 E
--------	---------------------------------------	--------------	---------------

Delete	light beacon	27° 03'.4 S	153° 17'.7 E
--------	--------------	-------------	--------------

Aus 236 [666/2015]

Insert	light beacon, Q.G M1, without topmark	27° 03'.47 S	153° 17'.88 E
--------	---------------------------------------	--------------	---------------

Delete	light beacon	27° 03'.4 S	153° 17'.7 E
--------	--------------	-------------	--------------

Aus 814 [1225/2015]

Amend	light beacon to FI.R.4s M2	27° 03'.5 S	153° 18'.8 E
-------	----------------------------	-------------	--------------

Aus 815 [991/2015]

Amend	light beacon to FI.R.4s M2	27° 03'.5 S	153° 18'.8 E
-------	----------------------------	-------------	--------------

34* AUSTRALIA - QUEENSLAND - Mourilyan - Lights

Maritime Safety Queensland Notice 365/2015 (SIRF2015002414)

Aus 258 (plan, Gladys Inlet to King Reefs) [1046/2015]

Amend	light to F.Bu (F Day)	17° 36'.0 S	146° 07'.1 E
	light to F.Bu (F Day)	17° 36'.0 S	146° 07'.3 E

Aus 258 (plan, Mourilyan Harbour) [1046/2015]

Amend	light to F.Bu (F Day)	17° 36'.02 S	146° 07'.12 E
	light to F.Bu (F Day)	17° 36'.02 S	146° 07'.28 E

35* AUSTRALIA - QUEENSLAND - Scarborough - Light beacon

Maritime Safety Queensland Notice 367/2015 (SIRF2015002457)

Aus 236 [33/2016]

Move	light beacon	27° 11'.59 S	153° 06'.14 E
	to	27° 11'.61 S	153° 06'.17 E

36* PAPUA NEW GUINEA - Hercules Bay - Nomenclature

National Maritime Safety Authority PNG (SIRF2015001961)

Aus 522 [1183/2015]

Insert	name, <i>Kainde Reef</i>	7° 54'.7 S	147° 48'.2 E
--------	--------------------------	------------	--------------

Delete	legend, (Rep 2015)	7° 54'.7 S	147° 48'.2 E
--------	--------------------	------------	--------------

37* PAPUA NEW GUINEA - Kieta Harbour to Banaru Reef - Light beacons

National Maritime Safety Authority PNG Notice 34/2015 (SIRF2015002381, SIRF2015002389)

Aus 399 [576/2015]

Amend	light to <i>Fl.R.5s</i>	6° 08'.8 S	155° 39'.5 E
	light to <i>Fl(2)G.8s</i>	6° 08'.3 S	155° 39'.0 E

Aus 683 (plan, Approaches to Kieta Harbour and Anewa Bay) [248/2014]

Substitute	light beacon, <i>Fl.R.5s 8m</i> , with port lateral topmark for light beacon	6° 08'.8 S	155° 39'.5 E
	light beacon, <i>Fl(2)G.8s 8m</i> , with starboard lateral topmark for light beacon	6° 08'.3 S	155° 39'.0 E

Amend	light beacon to <i>Fl(2)R.12s 8m</i>	6° 10'.1 S	155° 39'.0 E
	light beacon to <i>Fl.G.5s</i>	6° 12'.5 S	155° 38'.3 E

Aus 683 (plan, Kieta Harbour) [248/2014]

Amend	light beacon to <i>Fl.G.5s 9m</i>	6° 12'.53 S	155° 38'.34 E
-------	-----------------------------------	-------------	---------------

Aus 4622 (INT 622) [1184/2015]

Delete	light	6° 08'.8 S	155° 39'.5 E
--------	-------	------------	--------------

38* PAPUA NEW GUINEA - NEW BRITAIN - Elizabeth Reef - Wreck

National Maritime Safety Authority PNG Notice 38(T)/2015 (SIRF2016002524)

Aus 545 [134/2013]

Insert	stranded wreck	4° 06'.80 S	151° 27'.53 E
--------	----------------	-------------	---------------

Aus 546 [NC 14/3/2014]

Insert	stranded wreck	4° 06'.80 S	151° 27'.53 E
--------	----------------	-------------	---------------

39* PAPUA NEW GUINEA - Oreore Channel - Light beacons

National Maritime Safety Authority PNG Notices 35/2015, 37/2015 (SIRF2015002381, SIRF2015002389)

Aus 628 [1113/2014]

Amend	light beacon to <i>Fl.R.4s</i>	10° 13'.14 S	150° 52'.67 E
	light beacon to <i>Fl.R.4s</i>	10° 13'.37 S	150° 52'.62 E

40* PAPUA NEW GUINEA - Padana Nahua Passage - Depths
Geopolynesie (SIRF2015002198)

Aus 379 [1228/2015]

Substitute	depth, 0 ₆ m, for depth, 1 ₄ m	9° 35'.1 S	147° 17'.5 E
------------	--	------------	--------------

Aus 505 [1229/2015]

Insert	contour, between	9° 33'.98 S	147° 17'.46 E
		9° 34'.09 S	147° 17'.44 E
		9° 34'.17 S	147° 17'.38 E
	depth, 16 ₄ m, and extend contour S to enclose	9° 34'.68 S	147° 17'.56 E

Substitute	depth, 9 ₃ m, for depth, 13 ₃ m	9° 33'.9 S	147° 17'.3 E
	depth, 0 ₆ m, for depth, 1 ₄ m	9° 35'.1 S	147° 17'.5 E

Delete	depth, 20 ₃ m	9° 34'.7 S	147° 17'.6 E
--------	--------------------------	------------	--------------

Aus 621 [1285/2015]

Insert	depth, 16 ₄ m, enclosed by contour	9° 34'.680 S	147° 17'.560 E
	depth, 0 ₆ m, and extend contour NW to enclose	9° 35'.140 S	147° 17'.520 E

Substitute	depth, 9 ₃ m, for depth, 13 ₃ m	9° 33'.94 S	147° 17'.29 E
	depth, 7 ₆ m, for depth, 13 ₈ m	9° 34'.77 S	147° 16'.92 E

Delete	depth, 20 ₃ m	9° 34'.70 S	147° 17'.58 E
	depth, 1 ₄ m	9° 35'.15 S	147° 17'.55 E

41* AUSTRALIA - TORRES STRAIT - Channel Rock to Madge Reef - Wrecks

Former Notices - 195(T)/2015, 197(T)/2015 are cancelled

Maritime Safety Queensland Notices 9(T)/2015, 10(T)/2015 (AA786406, AA786408, SIRF2015002469)

Aus 293 [1143/2015]

Insert	dangerous wreck, centred on	10° 33'.143 S	142° 15'.126 E
	dangerous wreck, centred on	10° 35'.556 S	142° 14'.631 E

Delete	depth, 5 ₃ m	10° 33'.13 S	142° 15'.10 E
--------	-------------------------	--------------	---------------

Aus 299 [989/2015]

Insert	dangerous wreck, centred on	10° 33'.143 S	142° 15'.126 E
	dangerous wreck, centred on	10° 35'.556 S	142° 14'.631 E

Aus 700 [1185/2015]

Insert	dangerous wreck, centred on	10° 33'.14 S	142° 15'.13 E
--------	-----------------------------	--------------	---------------

42* AUSTRALIA - NORTHERN TERRITORY - Darwin - LNG Terminal - Topmark

R Plummer (SIRF2016002597)

Aus 24 [1288/2015]

Substitute	triangular topmark apex up for topmark	12° 31'.55 S	130° 51'.70 E
------------	--	--------------	---------------

43* AUSTRALIA - WESTERN AUSTRALIA - Dampier - Woodside Channel - Light buoy

Pilbara Ports Authority Notice D39/2015 (SIRF2015002396)

Aus 58 [1235/2015]

Insert	special spherical light buoy, Fl(5)Y.20s, without topmark	20° 26'.16 S	116° 43'.86 E
--------	---	--------------	---------------

44* AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Scientific instrument northwestwards

MetOcean Engineers (SIRF2015002228), UKHO (SIRF2015002466)

Aus 328 [1355/2015]

Move	light buoy	20° 05'.35 S	115° 10'.19 E
	to	20° 04'.76 S	115° 11'.43 E

45* AUSTRALIA - WESTERN AUSTRALIA - Onslow - Plan withdrawn; ZOC diagram

Australian Hydrographic Service (AA847162), Chevron Australia Pty Ltd (SIRF2015000870)

Aus 64 [1147/2015]

Insert	accompanying block A	21° 36'.5 S	115° 12'.0 E
	accompanying block B	21° 17'.0 S	114° 55'.0 E
	magenta continuous line, between	21° 36'.30 S	115° 03'.83 E
		21° 36'.04 S	115° 03'.83 E
		21° 36'.04 S	115° 08'.60 E
		21° 36'.30 S	115° 08'.60 E
	magenta legend, Aus 69	21° 36'.10 S	115° 08'.34 E
Delete	continuous line, between	21° 36'.3 S	115° 03'.8 E
		21° 36'.3 S	115° 08'.6 E
	legend, see Plan	21° 36'.4 S	115° 08'.3 E

Aus 64 (plan, Onslow) [1147/2015]

Delete	plan, ONSLOW	21° 37'.5 S	115° 06'.0 E
--------	--------------	-------------	--------------

46* AUSTRALIA - VICTORIA - Port Phillip - Geelong - Point Richards Channel - Anchorage; port limit*Former Notice - 398(T)/2015 is cancelled*

Victorian Regional Channels Authority Notice 257/2015 (SIRF2015002433)

Aus 143 [1301/2015]

Insert	magenta dashed line, between	38° 03'.63 S	144° 40'.08 E
		38° 05'.62 S	144° 40'.08 E
Delete	magenta dashed line, between	38° 03'.7 S	144° 40'.0 E
		38° 05'.6 S	144° 40'.0 E

Aus 157 [1301/2015]

Insert	accompanying block	38° 04'.66 S	144° 39'.54 E
--------	--------------------	--------------	---------------

47* AUSTRALIA - VICTORIA - Port Phillip - Williamstown - Breakwater Pier - Infrastructure; nav aids

Port of Melbourne Corporation (SIRF2015002065, SIRF2016002662)

Aus 154 [1363/2015]

Insert	accompanying block	37° 51'.9 S	144° 55'.0 E
--------	--------------------	-------------	--------------

48* AUSTRALIA - VICTORIA - Torquay - Artificial reef

Maritime Safety Victoria Notice 117/2015 (AA815920)

Aus 143 [46/2016]

Insert	fish haven with minimum depth, 22m, between	38° 20'.07 S	144° 22'.23 E
		38° 20'.18 S	144° 22'.32 E
		38° 19'.94 S	144° 22'.60 E
		38° 19'.83 S	144° 22'.50 E
		38° 20'.07 S	144° 22'.23 E
Delete	depth, 25 ₇ m	38° 20'.0 S	144° 22'.5 E
Insert	fish haven symbol with minimum depth, 22m, centred on	38° 20'.0 S	144° 22'.4 E
Delete	depth, 27m	38° 20'.0 S	144° 22'.4 E

49(T)/2016 AUSTRALIA - NEW SOUTH WALES - Botany Bay - Depth information revoked*Former Notice - 674(T)/2015 is cancelled*

Australian Hydrographic Service (AA350099)

Cancel this notice on receipt.

Chart formerly affected - Aus 196 - Aus 198 - Aus 199**50(T)/2016 AUSTRALIA - NEW SOUTH WALES - Cabbage Tree Bay - Scientific instruments***Date - Until 30 June 2017*

Sydney Institute of Marine Science (SIRF2016002502)

Subsurface scientific instruments exist in positions 33° 48'.03 S 151° 18'.03 E and 33° 47'.92 S 151° 17'.61 E.

Chart temporarily affected - Aus 197 - Aus 200 - Aus 201 - AX 00200T - AX 00201T**51(T)/2016 AUSTRALIA - NEW SOUTH WALES - Cabbage Tree Bay to Curl Curl Head - Scientific instruments***Former Notice - 699(T)/2013 is cancelled*

Sydney Institute of Marine Science (SIRF2016002502)

Cancel this notice on receipt.

Chart formerly affected - Aus 197 - Aus 200 - Aus 201 - AX 00201T - AX 63200**52(T)/2016 AUSTRALIA - NEW SOUTH WALES - Cape Baily to Ben Buckler - Scientific instruments***Date - Until 30 June 2017*

Sydney Institute of Marine Science (SIRF2016002502)

Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
33° 53'.74 S 151° 17'.30 E	20
33° 53'.98 S 151° 17'.71 E	40
33° 54'.23 S 151° 18'.14 E	57
33° 54'.49 S 151° 18'.55 E	61
33° 54'.76 S 151° 19'.01 E	61
33° 55'.02 S 151° 19'.45 E	61
33° 55'.28 S 151° 19'.88 E	68
33° 55'.53 S 151° 20'.31 E	67
33° 55'.80 S 151° 20'.74 E	77
33° 56'.06 S 151° 21'.18 E	77
33° 56'.33 S 151° 21'.61 E	79
33° 56'.60 S 151° 22'.08 E	84
33° 56'.86 S 151° 22'.51 E	87
33° 57'.13 S 151° 22'.95 E	97
33° 57'.39 S 151° 23'.39 E	118
33° 57'.93 S 151° 24'.26 E	On the seabed
34° 00'.22 S 151° 27'.84 E	On the seabed
34° 00'.50 S 151° 28'.28 E	On the seabed
34° 00'.76 S 151° 28'.70 E	On the seabed
34° 01'.04 S 151° 29'.15 E	On the seabed
34° 01'.31 S 151° 29'.57 E	On the seabed
34° 01'.63 S 151° 30'.04 E	On the seabed.

Chart temporarily affected - Aus 197 - Aus 200 - Aus 808 - Aus 809 - AX 00200T - AX 00808S - AX 00809S

53(T)/2016 AUSTRALIA - NEW SOUTH WALES - Cape Baily to Ben Buckler - Scientific instruments*Former Notice* - 697(T)/2013 is cancelled

Sydney Institute of Marine Science (SIRF2016002502)

Cancel this notice on receipt.

Chart formerly affected - Aus 197 - Aus 200 - Aus 808 - Aus 809 - AX 00808S - AX 00809S - AX 63200**54(T)/2016 AUSTRALIA - NEW SOUTH WALES - Newcastle - Depth information revoked***Former Notice* - 941(T)/2015 is cancelled

Australian Hydrographic Service (AA350099)

Cancel this notice on receipt.

Chart formerly affected - Aus 207 - Aus 208 - Aus 809 - AX 00809S**55(T)/2016 AUSTRALIA - NEW SOUTH WALES - Port Jackson - Depth information revoked***Former Notice* - 784(T)/2015 is cancelled

Australian Hydrographic Service (AA350099)

Cancel this notice on receipt.

Chart formerly affected - Aus 200 - Aus 202 - AX 00202T**56(T)/2016 AUSTRALIA - NEW SOUTH WALES - Port Jackson - Western Channel - Scientific instruments***Date* - Until 30 November 2016

Port Authority of New South Wales (SIRF2016002552)

Scientific instruments marked by a special light buoy, *Fl.Y.5s*, exist in position 33° 50'.48 S 151° 15'.87 E.**Chart temporarily affected - Aus 200 - Aus 201 - AX 00200T - AX 00201T****57(T)/2016 AUSTRALIA - NEW SOUTH WALES - Port Jackson - Athol Bay - Mooring buoy restored***Former Notice* - 1310(T)/2015 is cancelled

Port Authority of New South Wales Notice 1/2016 (SIRF2016002598)

Cancel this notice on receipt.

Chart formerly affected - Aus 200 - Aus 202 - AX 00202T**58(T)/2016 AUSTRALIA - NEW SOUTH WALES - Port Stephens - Boondelbah Island - Rock charted***Former Notice* - 942(P)/2015 is cancelled

Office of Environment and Heritage NSW (Dataset 2961431)

NTM 1180/2015 refers.

Cancel this notice on receipt.

Chart formerly affected - Aus 209**59(T)/2016 AUSTRALIA - TASMAN SEA - Live firing completed***Former Notice* - 1196(T)/2015 is cancelled

Royal Australian Air Force (SIRF2015001821)

Cancel this notice on receipt.

Chart formerly affected - Aus 489 - Aus 809 - Aus 810 - Aus 811 - Aus 4643 (INT 643) - AX 00809S

60(T)/2016 AUSTRALIA - QUEENSLAND - Airlie Beach - Abell Point - Dredging operations completed

Former Notice - 628(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 268

61(T)/2016 AUSTRALIA - QUEENSLAND - Cairns - Depth information revoked

Former Notices - 1068(T)/2014, 485(T)/2015 are cancelled
Australian Hydrographic Service (AA350099)

Cancel this notice on receipt.

Chart formerly affected - Aus 262 - Aus 263 - Aus 264 - Aus 830 - AX 00262T - AXA 0830T

62(T)/2016 AUSTRALIA - QUEENSLAND - Gladstone - Depths charted

Former Notice - 741(P)/2015 is cancelled
UKHO (AA853445)

Cancel this notice on receipt.

Chart formerly affected - Aus 246

63(T)/2016 AUSTRALIA - QUEENSLAND - Gold Coast - Broadwater - Dredging operations completed

Former Notice - 289(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 230 - Aus 814

64(T)/2016 AUSTRALIA - QUEENSLAND - Great Sandy Strait - Scientific instrument recovered

Former Notice - 1063(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 241 - Aus 817

65(T)/2016 AUSTRALIA - QUEENSLAND - Hay Point - Moorings removed

Former Notice - 135(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 249 - Aus 250 - Aus 823 - AX 00249S - AX 00823S

66(T)/2016 AUSTRALIA - QUEENSLAND - Karumba - Light beacon restored

Former Notice - 1064(T)/2015 is cancelled
Maritime Safety Queensland Notice 369/2015 (SIRF2015002459)

Cancel this notice on receipt.

Chart formerly affected - Aus 6

67(T)/2016 AUSTRALIA - QUEENSLAND - Karumba - Shoaling
 Maritime Safety Queensland Notice 2(T)/2016 (SIRF2016002616)

Shoaling exists in the entrance channel between beacon No6 (17° 26'.08 S 140° 44'.22 E) and beacon No12 (17° 26'.65 S 140° 45'.51 E).

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 6

68(T)/2016 AUSTRALIA - QUEENSLAND - Karumba - Light relit
Former Notice - 293(T)/2015 is cancelled
 Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 6 - Aus 303

69(T)/2016 AUSTRALIA - QUEENSLAND - Lindeman Island - Scientific instrument
Former Notice - 1156(T)/2015 is cancelled
Date - Until 15 April 2016
 Maritime Safety Queensland Notice 11/2016 (SIRF2016002686)

A scientific instrument marked by a special light buoy, *Fl.4s*, exists in position 20° 27'.79 S 149° 02'.30 E.

Chart temporarily affected - Aus 252 - Aus 254

70(T)/2016 AUSTRALIA - QUEENSLAND - Mackay - Harbour works
Date - Until 29 June 2016
 Maritime Safety Queensland Notice 9(T)/2016 (SIRF2016002673)

Harbour works are in progress in the vicinity of berth No1 (21° 06'.54 S 149° 13'.71 E).

Mariners are advised to navigate with caution in the vicinity.

Chart temporarily affected - Aus 250

71(T)/2016 AUSTRALIA - QUEENSLAND - Pumicestone Channel - Light beacon relit
Former Notice - 959(T)/2015 is cancelled
 Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 235 - Aus 236

72(T)/2016 AUSTRALIA - QUEENSLAND - Shute Harbour - Light relit
Former Notice - 1315(T)/2015 is cancelled
 Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 252 - Aus 253

73(T)/2016 AUSTRALIA - QUEENSLAND - Townsville - Sea Channel - Light beacon damaged
 Maritime Safety Queensland Notice 376(T)/2015 (SIRF2016002585)

The light beacon, *Q.R S2* (19° 08'.46 S 146° 53'.39 E), has been damaged; two temporary lights, *Q.R*, exist on the beacon.

Mariners are advised to navigate with caution in the area as the lights may be obscured when approaching the beacon from certain directions.

Chart temporarily affected - Aus 256 - Aus 827

74(T)/2016 AUSTRALIA - QUEENSLAND - Townsville - Dredging operations completed

Former Notice - 1373(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 256 - Aus 257 - Aus 827

75(T)/2016 AUSTRALIA - QUEENSLAND - Townsville - Depth information revoked

Former Notice - 962(T)/2015 is cancelled
Australian Hydrographic Service (AA350099)

Cancel this notice on receipt.

Chart formerly affected - Aus 256 - Aus 257 - Aus 827

76(T)/2016 AUSTRALIA - QUEENSLAND - Townsville - Platypus Channel - Scientific instruments recovered

Former Notice - 1374(T)/2015 is cancelled
Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 256 - Aus 257

77(T)/2016 AUSTRALIA - CORAL SEA - Moreton Island - Scientific instrument

Former Notice - 1316(T)/2015 is cancelled
CSIRO (SIRF2015002437)

Cancel this notice on receipt.

Chart formerly affected - Aus 814

78(T)/2016 PAPUA NEW GUINEA - Bougainville Island - Lights unlit

Former Notice - 279(T)/2014 is cancelled
National Maritime Safety Authority PNG Notices 22/2011, 46/2011, 52/2011, 34/2015, 35/2015, 37/2015) (AA535709, AA565338, AA569723, SIRF2015002381, SIRF2015002389)

The following lights are unlit:

<i>Location</i>	<i>Position</i>
Otua Island (K4886)	6° 27'.50 S 155° 58'.40 E
Takanupei Island (K4884.4)	6° 08'.86 S 155° 34'.31 E
Cape Laverdy (K4884)	5° 32'.49 S 155° 03'.88 E.

Chart temporarily affected - Aus 399 - Aus 683 - Aus 4622 (INT 622)

79(T)/2016 PAPUA NEW GUINEA - Cape Nelson - Daia Point - Light unlit

National Maritime Safety Authority PNG Notice 3(T)/2016 (SIRF2016002621)

The light, *Fl.6s 19m 10M* (8° 59'.50 S 149° 08'.33 E), is unlit.

Chart temporarily affected - Aus 520 - Aus 4620 (INT 620) - Aus 4621 (INT 621) - AX 04620U - AX 04621S - AX 04621U

80(T)/2016 PAPUA NEW GUINEA - Dampier Strait - Nesup Channel - Light buoy restored

Former Notice - 432(T)/2015 is cancelled
National Maritime Safety Authority PNG Notice 1/2016 (SIRF2016002619)

Cancel this notice on receipt.

Chart formerly affected - Aus 673

81(T)/2016 PAPUA NEW GUINEA - Kitava Island - Light unlit

National Maritime Safety Authority PNG Notice 2(T)/2016 (SIRF2016002620)

The light, *Fl.7-5s 107m 10M* (8° 38'.71 S 151° 20'.30 E), is unlit.**Chart temporarily affected - Aus 515 - Aus 516 - Aus 637 - Aus 4621 (INT 621) - AX 04621S - AX 04621U****82(T)/2016 PAPUA NEW GUINEA - Rothery Passage - Light beacon unlit**

National Maritime Safety Authority PNG Notice 4(T)/2016 (SIRF2016002622)

The light beacon, *Fl(3)15s 22m 10M* (10° 21'.07 S 148° 41'.46 E), is unlit.**Chart temporarily affected - Aus 506 - Aus 4604 (INT 604) - Aus 4620 (INT 620) - Aus 4621 (INT 621) - AX 04604U - AX 04620U - AX 04621S - AX 04621U****83(T)/2016 PAPUA NEW GUINEA - Uluma Reef to Gulf of Papua - Seismic survey**

Date - Until 31 March 2016

Searcher Seismic Pty Ltd (SIRF2016002517)

MV *BGP Explorer*, towing 10500m cable, is conducting a survey in the area bounded by the following positions:

9° 50'.92 S 144° 44'.20 E
 9° 28'.94 S 144° 14'.60 E
 8° 51'.09 S 143° 35'.70 E
 7° 54'.80 S 144° 44'.86 E
 7° 54'.44 S 145° 15'.98 E
 8° 21'.87 S 146° 12'.26 E
 9° 00'.83 S 146° 34'.20 E
 10° 07'.97 S 147° 43'.60 E
 10° 30'.13 S 149° 35'.47 E
 10° 59'.17 S 150° 43'.43 E
 11° 46'.89 S 150° 02'.57 E
 11° 55'.11 S 146° 12'.31 E.

Mariners are advised to navigate with caution in the area. 7M clearance requested.

Chart temporarily affected - Aus 376 - Aus 377 - Aus 378 - Aus 379 - Aus 502 - Aus 505 - Aus 506 - Aus 507 - Aus 508 - Aus 621 - Aus 623 - Aus 647 - Aus 840 - Aus 4603 (INT 603) - Aus 4604 (INT 604) - Aus 4620 (INT 620) - Aus 4621 (INT 621) - Aus 4622 (INT 622) - AX 04603U - AX 04604U - AX 04620U - AX 04621S - AX 04621U**84(T)/2016 AUSTRALIA - TORRES STRAIT - Kai-Maituine Reef - Wreck**

Australian Maritime Safety Authority (SIRF2016002665)

A stranded wreck exists in position 10° 15'.20 S 143° 06'.55 E.

Chart temporarily affected - Aus 839**85(T)/2016 AUSTRALIA - TORRES STRAIT - Madge Reef - Light beacon restored**

Former Notice - 1030(T)/2014 is cancelled

Maritime Safety Queensland (AA841968)

Cancel this notice on receipt.

Chart formerly affected - Aus 293 - Aus 299

86(T)/2016 AUSTRALIA - NORTHERN TERRITORY - Darwin - East Arm - Nav aids unlit

Former Notice - 1378(T)/2015 is cancelled

Department of Transport NT Notices 153(T)/2015, 154(T)/2015, 157(T)/2015, 158(T)/2015, 162(T)/2015, 163(T)/2015 (SIRF2015002332, SIRF2015002333, SIRF2015002404, SIRF2015002402, SIRF2016002526, SIRF2016002528)

The following nav aids are unlit:

<i>Characteristic</i>	<i>Position</i>
Q.R F2	12° 28'.14 S 130° 51'.10 E
Fl.G.3s B01	12° 29'.16 S 130° 51'.80 E
Q B02	12° 30'.01 S 130° 53'.11 E
Fl.R.3s B04	12° 30'.00 S 130° 53'.71 E
F & Al.WRG Fl.Y.2s	12° 29'.65 S 130° 53'.58 E
Q.G H3	12° 29'.28 S 130° 55'.47 E

Chart temporarily affected - Aus 24 - Aus 26 - Aus 28 - AX 00026T

87(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Ashburton Road - Anchorages; pilot boarding place; recommended track; pilotage area

Former Notice - 1073(T)/2015 is cancelled

Date - Until 1 October 2016

Chevron Australia Pty Ltd (SIRF2015001174), UKHO (AA853445)

Temporary anchorages with a 400m radius swinging circle exist as follows:

<i>Anchorage design</i>	<i>Position</i>
A1	21° 30'.24 S 115° 02'.32 E
A2	21° 30'.73 S 115° 02'.31 E
A3	21° 31'.20 S 115° 02'.30 E
A4	21° 32'.31 S 114° 57'.45 E
A5	21° 32'.32 S 114° 57'.94 E
A6	21° 32'.78 S 114° 57'.45 E
A7	21° 32'.78 S 114° 57'.94 E
A8	21° 32'.32 S 114° 58'.43 E
A9	21° 32'.79 S 114° 58'.43 E

A temporary pilot boarding place exists in position 21° 35'.84 S 115° 00'.50 E.

A temporary recommended track bearing 142° - 322° exists between positions 21° 32'.78 S 114° 57'.94 E and 21° 35'.84 S 115° 00'.50 E.

A temporary compulsory pilotage area exists south of a line between positions 21° 37'.00 S 114° 56'.78 E and 21° 37'.00 S 115° 04'.56 E within the port limit.

Chart temporarily affected - Aus 64 - Aus 69 - Aus 743

88(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Ashburton Road - Mooring buoys

Former Notice - 1384(T)/2015 is cancelled

Chevron Australia Pty Ltd (SIRF2015000253, SIRF2015002352)

Lit mooring buoys, *Fl.Y.4s*, exist in the following positions:

21° 39'.69 S 115° 01'.29 E
21° 39'.50 S 115° 01'.18 E
21° 39'.22 S 115° 01'.38 E
21° 38'.93 S 115° 01'.96 E.

Chart temporarily affected - Aus 64 - Aus 69 - Aus 743

89(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Drill rig northwestwards

Date - Until 8 February 2016

Quadrant Energy (SIRF2015002324)

Drill rig *Noble Tom Prosser* is conducting drilling operations in position 20° 28'.92 S 115° 10'.98 E.

Chart temporarily affected - Aus 328 - Aus 742 - Aus 4723 (INT 723) - AX 04723U

90(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Town Point - Mooring buoys recovered*Former Notice* - 311(T)/2015 is cancelled

Port of Barrow Notice 20/2015 (SIRF2016002645)

Cancel this notice on receipt.

Chart formerly affected - Aus 62 - Aus 66**91(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Bedout Island - Drill rig northwards moved***Former Notice* - 1259(T)/2015 is cancelled

Quadrant Energy (SIRF2015002324)

Cancel this notice on receipt.

Chart formerly affected - Aus 325 - Aus 326 - Aus 4722 (INT 722) - AX 04722U**92(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Browse Island - Drill rig northwestwards moved***Former Notice* - 922(T)/2013 is cancelled

Shell Australia (SIRF2015002310)

Cancel this notice on receipt.

Chart formerly affected - Aus 319 - Aus 320 - Aus 4721 (INT 721) - Aus 4722 (INT 722) - AX 00319U - AX 04721U - AX 04722U**93(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Browse Island - Pipeline operations northwestwards***Date* - Until 30 August 2016

McDermott Australia Pty Ltd (SIRF2016002596)

Vessels *LV 108*, *Loch Seaforth* and support vessel *Westsea Tripet* are conducting pipeline installation works in an area bounded by the following positions:

13° 44'.0 S 123° 05'.0 E

13° 44'.0 S 123° 20'.0 E

14° 00'.0 S 123° 20'.0 E

14° 00'.0 S 123° 05'.0 E.

Mariners are advised to navigate with caution in the area. 2.5M clearance requested.

Chart temporarily affected - Aus 319 - Aus 320 - Aus 322 - AX 00319S - AX 00319U - AX 00320S - AX 00322U**94(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Glomar Shoal - Drill rig westwards moved***Former Notice* - 1263(T)/2015 is cancelled

Woodside Energy Ltd (SIRF2016002501)

Cancel this notice on receipt.

Chart formerly affected - Aus 327 - Aus 4723 (INT 723) - AX 04723U**95(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Glomar Shoal - Drill rig northwestwards***Date* - Until 19 February 2016

Quadrant Energy (SIRF2015002374)

Drill rig *Ocean Monarch* is conducting drilling operations in position 18° 53'.15 S 116° 33'.40 E.**Chart temporarily affected - Aus 327 - Aus 4722 (INT 722) - Aus 4723 (INT 723) - AX 04722U - AX 04723U**

96(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Mooring buoys northwards removed

Former Notice - 1208(T)/2015 is cancelled
 Viking Seatech (SIRF2016002530)

Cancel this notice on receipt.

Chart formerly affected - Aus 328

97(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Scientific instruments northeastwards

Former Notice - 1387(T)/2015 is cancelled

Date - Until 15 February 2016

Jacobs (SIRF2015002476), A Lemmon (SIRF2016002655)

Scientific instruments exist as follows:

<i>Position</i>	<i>Remarks</i>
19° 54'.95 S 115° 23'.11 E	special light buoy, Q. Y
19° 55'.22 S 115° 22'.99 E	15m subsurface
19° 55'.22 S 115° 23'.10 E	special light buoy, Q. Y
19° 55'.49 S 115° 23'.81 E	20m subsurface
19° 54'.17 S 115° 21'.36 E	20m subsurface
19° 55'.06 S 115° 23'.47 E	20m subsurface

Chart temporarily affected - Aus 327 - Aus 328

98(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Drill rig northwestwards moved

Former Notice - 1031(T)/2015 is cancelled

Quadrant Energy (SIRF2016002562)

Cancel this notice on receipt.

Chart formerly affected - Aus 328 - Aus 4723 (INT 723) - AX 04723U

99(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Pipe laying northwards completed

Former Notice - 445(T)/2015 is cancelled

Woodside Energy Ltd (SIRF2015002366, SIRF2015002390)

Cancel this notice on receipt.

Chart formerly affected - Aus 327 - Aus 328

100(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Muiron Islands - Light buoys northwestwards recovered

Former Notice - 388(T)/2015 is cancelled

B Cooper (SIRF2015002424)

Cancel this notice on receipt.

Chart formerly affected - Aus 328 - Aus 329 - Aus 744

101(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Muiron Islands - Drill rig northwestwards

Former Notice - 1325(T)/2015 is cancelled

Date - Until 7 February 2016

MODU *Atwood Falcon* (SIRF2016002529), Australian Maritime Safety Authority Auscoast Warning 3/2016 (SIRF2016002500), BHP Billiton Petroleum Pty Ltd (SIRF2015002354)

Drill rig *Atwood Falcon* is conducting drilling operations in position 21° 31.80 S 114° 05'.15 E.

Chart temporarily affected - Aus 328 - Aus 329 - Aus 744 - Aus 4723 (INT 723) - Aus 4725 (INT 725) - AX 04723U

102(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - North West Reefs - AIS operational

Former Notice - 259(T)/2015 is cancelled
Pilbara Ports Authority (SIRF2016002654)

Cancel this notice on receipt.

Chart formerly affected - Aus 57 - Aus 741 - Aus 742

103(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Port Walcott - Drill rig northeastwards

Date - Until 28 February 2016
Woodside Energy Ltd (SIRF2015002501)

Drill rig *Atwood Eagle* is conducting drilling operations in position 19° 40'.78 S 117° 21'.08 E.

Chart temporarily affected - Aus 326 - Aus 4722 (INT 722) - Aus 4723 (INT 723) - AX 04722U - AX 04723U

104(T)/2016 AUSTRALIA - WESTERN AUSTRALIA - Rankin Bank - Mooring buoys southwestwards

Viking Seatech (SIRF2016002521)

12 yellow mooring buoys, *Fl.3s*, exist within 1M radius of 19° 54'.35 S 115° 16'.12 E.

Chart temporarily affected - Aus 328

105(T)/2016 AUSTRALIA - SOUTH AUSTRALIA - Cape Jaffa - Margaret Brock Reef - Light relit

Former Notice - 318(T)/2015 is cancelled
Department of Planning, Transport and Infrastructure SA (SIRF2016002488)

Cancel this notice on receipt.

Chart formerly affected - Aus 127 - Aus 347

106(T)/2016 AUSTRALIA - SOUTH AUSTRALIA - Port Augusta - Curlew Island - Harbour works completed

Former Notice - 319(T)/2015 is cancelled
Department of Planning, Transport and Infrastructure SA (SIRF2016002492)

Cancel this notice on receipt.

Chart formerly affected - Aus 132

107(T)/2016 AUSTRALIA - SOUTH AUSTRALIA - Yatala Channel - Shoaling removed

Former Notice - 1203(T)/2014 is cancelled
Department of Planning, Transport and Infrastructure SA Notice 16/2015 (AA818359)

Cancel this notice on receipt.

Chart formerly affected - Aus 122

108(T)/2016 AUSTRALIA - VICTORIA - Port Phillip - The Narrows - Light beacon damaged

Former Notice - 1398(T)/2015 is cancelled
Parks Victoria Notice 263(T)/2015 (SIRF2016002495)

No6 light beacon, *Fl(2)R.4s* (38° 13'.92 S 144° 43'.47 E) has been damaged and temporarily removed. A port lateral light buoy, *Fl(2)R.4s*, exists in position 38° 13'.92 S 144° 43'.48 E.

Chart temporarily affected - Aus 158

109(T)/2016 AUSTRALIA - VICTORIA - Port Phillip - Port of Melbourne - Dredging operations

Date - Until 30 May 2016

Port of Melbourne Corporation Notice 7(T)/2016 (SIRF2016002611)

The dredge *Storken* and support vessels *Discovery*, *Endeavour* and *Kythira* are conducting dredging operations in the major berths and swing basins within the Port of Melbourne.

Mariners are advised to navigate with caution in the vicinity of the dredging operations.

Chart temporarily affected - Aus 154 - Aus 155

110(T)/2016 AUSTRALIA - TASMANIA - Great Oyster Bay - Bryans Beach - Wreck

Marine and Safety Tasmania Notice M1/2016 (SIRF2016002533)

A wreck exists in position 42° 15'.39 S 148° 16'.69 E.

Chart temporarily affected - Aus 169 - Aus 766 - AX 00766S

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

Former Notices - 816(T)/2015, 1130(T)/2015 are cancelled
 Australian Hydrographic Service (AA837335)

Notice	Charts affected	Locality and Subject
BASS STRAIT		
1401/2015	Aus487 789 AX00487S	King Island
		Scientific instruments
CORAL SEA		
1038/2015 434/2014	Aus357 AX00357S Aus357 4644	Ninety Mile Beach
		Inspection works Light unlit
CORAL SEA		
639/2015	Aus4604 AX04604U	Bampton Reef
		Light buoy off station northwards
NEW SOUTH WALES		
1249/2015	Aus813	Ballina
		Light buoy off station
179/2015	Aus196 198 199	Botany Bay
		Harbour works
50/2016	Aus197 200 201 AX00200T 00201T	Cabbage Tree Bay
		Scientific instruments
52/2016	Aus197 200 808 809 AX00200T 00808S 00809S	Cape Baily to Ben Buckler
		Scientific instruments
43/2015 837/2015 880/2015 881/2015	Aus222 Aus222 Aus222 Aus222	Clarence River
		Obstructions
		Dredging operations
		Harbour works
882/2015	Aus222	Harbour works
		Harbour works
882/2015	Aus806	Green Cape
		Light buoy off station
939/2015	Aus204 217 AX00215T	Hawkesbury River
		Light buoy
1113/2015	Aus193 AX00193P 00193T AXA0193T	Jervis Bay
		Lights unlit
56/2016	Aus200 201 AX00200T 00201T	Port Jackson
		Scientific instruments
680/2015	Aus194 195	Port Kembla
		Dredging operations; light withdrawn
NORTHERN TERRITORY		
1071/2015	Aus309 722 AX00309S 00309T 00309U 00722T	Charles Point
		Drill rig northwestwards

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
		<i>Darwin</i>
910/2012	Aus28	Obstruction
919/2013	Aus24 26 27 28 AX00026T	Scientific instruments
790/2014	Aus26 28 AX00026T	Harbour works
143/2015	Aus26 AX00026T	Obstruction
144/2015	Aus28	Scientific instruments
145/2015	Aus24	Light altered
892/2015	Aus26 27 AX00026T	Pipeline; buoys
893/2015	Aus26 28 AX00026T	Scientific instruments
1320/2015	Aus26 28 AX00026T	Harbour works
1376/2015	Aus28	Dredging operations
86/2016	Aus24 26 28 AX00026T	Nav aids unlit
		<i>East Arm</i>
894/2015	Aus28	Lights
		<i>East Vernon Island</i>
1193/2014	Aus20	Obstruction
		<i>Evans Shoal</i>
848/2015	Aus309 310 722 AX00309S 00309T 00309U 00310U 00722T	Scientific instruments eastwards
		QUEENSLAND
		<i>Airlie Beach</i>
1210/2011	Aus268	Obstructions
167/2014	Aus252 253 268	Wreck
130/2015	Aus253 268	Wreck; light buoy
1061/2015	Aus253 268	Harbour works
		<i>Bait Reef</i>
872/2011	Aus254 825	Light beacon destroyed
		<i>Bowen</i>
269/2014	Aus268	Wreck
		<i>Boyd Point</i>
1005/2015	Aus301	Scientific instruments
		<i>Bundaberg</i>
105/2013	Aus243 817 818	Obstruction northeastwards
		<i>Cairns</i>
129/2014	Aus263	Wreck
		<i>Cape Bowling Green</i>
1214/2013	Aus826 827	Scientific instrument
912/2014	Aus826 827	Light buoy off station eastwards
		<i>Cape Cleveland</i>
559/2013	Aus256 827	Wreck
		<i>Cape Tribulation</i>
1098/2013	Aus831 AXA0830T	Wreck; exclusion zone
		<i>Curtis Channel</i>
602/2012	Aus818	Wreck
		<i>Decapolis Reef</i>
1006/2015	Aus832	Light beacon; light buoy
		<i>Fitzroy River</i>
211/2013	Aus819	Wreck

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
1132/2014	Aus816 817	<i>Fraser Island</i> Wreck
947/2015	Aus249 251 AX00249S	<i>Freshwater Point to Keswick Island</i> Scientific instruments
579/2014 1232/2014	Aus245 246 819 Aus245 272	<i>Gladstone</i> Scientific instruments Anchorage area
690/2014	Aus247 490 819 820 AX00367S	<i>Great Keppel Island</i> Wreck
463/2013	Aus240 241	<i>Great Sandy Strait</i> Wreck
1250/2015	Aus254	<i>Hamilton Island</i> Harbour works
951/2015 1155/2015	Aus250 Aus249 823 AX00249S 00823S	<i>Hay Point</i> Scientific instrument Obstruction
602/2013	Aus259 828	<i>Hinchinbrook Channel</i> Wreck
1369/2015	Aus828	<i>Hinchinbrook Island</i> Light buoy withdrawn
460/2012	Aus252 254	<i>Hook Island</i> Light beacon destroyed
1188/2010	Aus251 252 824	<i>Io Reef</i> Light beacon destroyed; light buoy established
51/2015	Aus245 271	<i>Jacobs Channel</i> Light beacon damaged; light buoy established
67/2016	Aus6	<i>Karumba</i> Shoaling
543/2015	Aus819 820 AX00820S	<i>Keppel Isles</i> Light beacon destroyed
634/2015	Aus818 819	<i>Lady Musgrave Island</i> Wreck
757/2011 758/2011	Aus252 Aus252	<i>Laguna Quays</i> Lights unlit; light beacons damaged Shoaling
69/2016	Aus252 254	<i>Lindeman Island</i> Scientific instrument
743/2015	Aus259 267	<i>Lucinda</i> Light buoy off station; light buoy unlit
70/2016	Aus250	<i>Mackay</i> Harbour works
814/2013 379/2014 1072/2014	Aus256 Aus256 Aus256	<i>Magnetic Island</i> Obstruction Scientific instrument Scientific instrument

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
1313/2015	Aus235	<i>Mooloolaba</i> Wreck
1020/2011	Aus236	<i>Moreton Bay</i> Wreck; light buoy
302/2013	Aus236	Light beacon destroyed; light buoy established
740/2014	Aus236	Wreck
785/2014	Aus236	Shoaling
1157/2015	Aus235	Shoaling
1158/2015	Aus235 236 814 815	ALS trial
651/2013	Aus253 268	<i>Muddy Bay</i> Harbour works
512/2013	Aus820 AX00820S	<i>North Keppel Island</i> Wreck
215/2013	Aus258	<i>Oyster Point</i> Shoaling; obstructions
1270/2013	Aus235 236	<i>Pumicestone Channel</i> Wreck
1251/2015	Aus235 236	Beacon destroyed
376/2015	Aus294	<i>Red Island Point</i> Light buoys unlit
53/2013	Aus818	<i>Round Hill Head</i> Wreck
638/2015	Aus252 253	<i>Shute Bay</i> Wreck
763/2010	Aus252 253	<i>Shute Harbour</i> Wreck
1061/2013	Aus257	<i>Townsville</i> Wreck
232/2014	Aus256 257	Wreck
925/2014	Aus257	Wreck; light buoy
190/2015	Aus257	Light buoy withdrawn
73/2016	Aus256 827	Light beacon damaged
1274/2013	Aus831 832	<i>Two Islands</i> Wreck
1394/2010	Aus254	<i>Whitsundays</i> Buoy off station
592/2015	Aus252 254 824	Light beacon destroyed
SOUTH AUSTRALIA		
938/2014	Aus485 780	<i>Fleurieu Peninsula</i> Hulk; prohibited area
1344/2011	Aus781	<i>Gulf St Vincent</i> Obstruction
720/2008	Aus137	<i>Port Adelaide</i> Shoaling
853/2015	Aus130 138	Light beacon damaged; light buoy established
194/2014	Aus121	<i>Port Douglas</i> Light beacon destroyed

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
467/2014	Aus348	<i>Port Macdonnell</i> Harbour works
1099/2014	Aus135	<i>Whyalla</i> Light beacon destroyed
TASMANIA		
1335/2015	Aus173 795 796 AX00795S 00796S	<i>Bruny Island</i> Scientific instruments southeastwards
1074/2013	Aus487 798 800	<i>Cape Barren Island</i> Scientific instruments
706/2015	Aus173 795	<i>D'Entrecasteaux Channel</i> Marine farm
764/2015	Aus173 795	Marine farm
765/2015	Aus173 795	Marine farm
1336/2015	Aus767 798 AX00767S	<i>Eddystone Point</i> Scientific instruments southeastwards
1337/2015	Aus167 799 AX00799S	<i>Five Mile Bluff</i> Wreck
1338/2015	Aus793	<i>Flying Cloud Point</i> Scientific instruments westwards
199/2014	Aus179 800	<i>Franklin Sound</i> Lights unreliable
601/2015	Aus179 800	Shoaling; light unreliable
576/2012	Aus171 796	<i>Frederick Henry Bay</i> Scientific instruments
551/2014	Aus171 796	Light beacon destroyed
110/2016	Aus169 766 AX00766S	<i>Great Oyster Bay</i> Wreck
149/2014	Aus172	<i>Hobart</i> Beacon destroyed
1402/2015	Aus172	Harbour works
329/2015	Aus177	<i>Macquarie Harbour</i> Scientific instruments
122/2013	Aus170 766 797	<i>Maria Island</i> Scientific instruments
1103/2014	Aus170 766 797	<i>Mercury Passage</i> Obstructions
309/2014	Aus171 796	<i>Pipe Clay Head to Pitt Water</i> Scientific instruments
1178/2015	Aus171 172	<i>Port of Hobart</i> Harbour works
659/2015	Aus171 173	<i>River Derwent</i> Scientific instrument
707/2015	Aus168	<i>River Tamar</i> Light buoy
508/2015	Aus172	<i>Sandy Bay</i> Harbour works; Lit pile

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
103/2014	Aus169 766	<i>Schouten Passage</i> Wreck
1040/2015	Aus798	<i>Swan Island</i> Scientific instrument
984/2015	Aus173 795 796 AX00795S 00796S	<i>Trumpeter Bay</i> Marine farm; light buoys
1381/2015	Aus314 319 4721 4722 AX00314U 00319S 00319U 04721U 04722U	TIMOR SEA <i>Osborn Passage</i> Seismic survey
1382/2015	Aus314 319 4721 4722 AX00314U 00319S 00319U 04721U 04722U	<i>Pasco Passage</i> Oil field to be decommissioned northeastwards
223/2009	Aus312 4721 AX0312F 4721F	<i>Sahul Banks</i> Navaid; racon non operational
973/2014	Aus376 377 840	TORRES STRAIT <i>Darnley Island</i> Wreck
84/2016	Aus839	<i>Kai-Maituine Reef</i> Wreck
131/2012	Aus801	VICTORIA <i>Anderson Inlet</i> Shoaling
1271/2015	Aus349 AX00349S	<i>Cape Reamur</i> Exclusion zone; light buoy
1100/2014	Aus157	<i>Geelong</i> Light unlit; light discontinued
1217/2015	Aus182	<i>Lakes Entrance</i> Dredging operations
1331/2015	Aus143	<i>Mornington</i> Light unlit
197/2014	Aus143	<i>Port Phillip</i> Harbour works
607/2014	Aus155	Harbour works
760/2014	Aus144 158	Shoaling
987/2014	Aus143 155	Harbour works
399/2015	Aus143 158	Beacon destroyed
600/2015	Aus154	Harbour works
703/2015	Aus154	Harbour works
704/2015	Aus143 158	Harbour works
705/2015	Aus154	Harbour works
812/2015	Aus157	Shoaling
855/2015	Aus143	Shoaling
907/2015	Aus143 158	Harbour Works
1129/2015	Aus143 154 155	Dredging operations
1275/2015	Aus153	Barge
1333/2015	Aus154	Harbour works
1334/2015	Aus154	Harbour works; nav aids
1397/2015	Aus154	Harbour works
1400/2015	Aus143 158	Light altered; harbour works completed
108/2016	Aus158	Light beacon damaged
109/2016	Aus154 155	Dredging operations

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
563/2015	Aus182	<i>Port Welshpool</i> Shoaling
514/2008	Aus150 151	<i>Western Port</i> Shoaling northwards
102/2014	Aus150 151	AIS trial
608/2014	Aus150 151	Beacon destroyed
1101/2014	Aus150 151 788 801	Scientific instruments
WESTERN AUSTRALIA		
1108/2012	Aus109	<i>Albany</i> Harbour works
1383/2015	Aus64 328 743 744 4723 4725 AX04723U	<i>Ashburton Island</i> Platform unlit eastwards
793/2015	Aus64 743	<i>Ashburton Road</i> Nav aids
1204/2015	Aus64 328 743	Nav aid replacement
87/2016	Aus64 69 743	Anchorage; pilot boarding place; recommended track; pilotage area
88/2016	Aus64 69 743	Mooring buoys
425/2013	Aus62 67 742	<i>Barrow Island</i> Anchorage
74/2015	Aus62 66	Scientific instrument
794/2015	Aus66	Scientific instruments
897/2015	Aus66	Depth information
1120/2015	Aus328 4723 4725 AX04723U	Seismic survey north westwards
1258/2015	Aus328	Pipeline operations north westwards
1323/2015	Aus328	Scientific instruments north westwards
1385/2015	Aus62 65 66	Light buoy unlit
89/2016	Aus328 742 4723 AX04723U	Drill rig north westwards
1165/2015	Aus319 320 322 4721 4722 AX00319S 00319U 00320S 00322U 04721U 04722U	<i>Browse Island</i> Drill rig north westwards
1166/2015	Aus319 320 AX00319S 00319U 00320S	Pipeline operations north westwards
1261/2015	Aus319 320 AX00319S 00319U 00320S	Drill rig north westwards
93/2016	Aus319 320 322 AX00319S 00319U 00320S 00322U	Pipeline operations north westwards
228/2013	Aus115	<i>Bunbury</i> Shoaling
271/2013	Aus57 741 742	<i>Dampier</i> Obstruction
495/2015	Aus57 58	Anchorage closed westwards
851/2015	Aus57 327 741 742	<i>Dampier Archipelago</i> Obstruction eastwards
1262/2015	Aus327 741	Scientific instruments northwards
1077/2015	Aus111 117 334 754 AX00117T 00334S 00754S 06001S AXA0754S	<i>Direction Bank to Garden Island</i> Military exercise
1078/2015	Aus318 319 727 728 AX00318S 00319S 00319U	<i>East Holothuria Reef</i> Shoaling

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
555/2015	Aus119	<i>Esperance</i> Depth information
1057/2012	Aus113	<i>Fremantle</i> Depth information
433/2013	Aus81	<i>Geraldton</i> Depth information
95/2016	Aus327 4722 4723 AX04722U 04723U	<i>Glomar Shoal</i> Drill rig northwestwards
1207/2015	Aus109 110 AX00110S	<i>King George Sound</i> Light beacon damaged; light buoy
899/2015	Aus45 323 733	<i>King Sound</i> Light altered
1174/2013	Aus114 117 AX00117T	<i>Kwinana</i> Scientific instrument
444/2015	Aus320 323 730 732	<i>Lorikeet Shoal</i> Scientific instrument northwards
650/2015 1030/2015 1265/2015 97/2016	Aus328 Aus328 4723 AX04723U Aus327 328 742 Aus327 328	<i>Montebello Islands</i> Light buoys Pipeline works northwestwards Seismic survey northwestwards Scientific instruments northeastwards
1388/2015 101/2016	Aus328 329 744 Aus328 329 744 4723 4725 AX04723U	<i>Muiron Islands</i> Mooring buoys northwestwards Drill rig northwestwards
94/2015	Aus754 AX00754S AXA0754S	<i>Mullaloo</i> Light buoy
300/2014	Aus743	<i>Passage Islands</i> Obstructions
316/2013	Aus334 754 AX00334S 00754S AXA0754S	<i>Perth</i> Scientific instruments westwards
486/2013	Aus84	<i>Port Gregory</i> Shoaling
498/2015 1032/2015 1123/2015 1393/2015	Aus52 54 Aus52 53 326 739 740 Aus54 Aus53 739 740	<i>Port Hedland</i> Depth information Cable operations Light beacons; tug mooring Scientific instrument
1214/2015 103/2016	Aus55 57 326 327 740 741 Aus326 4722 4723 AX04722U 04723U	<i>Port Walcott</i> Drilling operations Drill rig northeastwards
701/2015 1124/2015 1268/2015 104/2016	Aus327 328 Aus327 328 329 Aus328 4723 AX04723U Aus328	<i>Rankin Bank</i> Scientific instruments southwestwards Scientific instruments Drill rig Mooring buoys southwestwards

111(T)/2016 AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
1169/2015	Aus43 322 4722 AX00322U 04722U	<i>Scott Reef</i> Drilling operations
1034/2015	Aus32	<i>Wyndham</i> Light buoys repositioned
1270/2015	Aus32	Shoaling
EAST TIMOR		
968/2015	Aus901	<i>Dili Bay</i> Obstruction
INDIAN OCEAN		
712/2014	Aus920	<i>Christmas Island</i> Harbour works
1038/2014	Aus4708 4714 4723 AX04708U 04714U 04723U	<i>Mid-Indian Ocean Basin</i> Light buoy off station
454/2015	Aus4070 4071	<i>Sumatera</i> Scientific instruments westwards
INDONESIA		
75/2014	Aus310 AX00310U	<i>Pulau Selaru</i> Scientific instruments southwestwards
PACIFIC OCEAN		
424/2015	Aus4604 4622 AX04604U	Scientific instruments
PAPUA NEW GUINEA		
78/2016	Aus399 683 4622	<i>Bougainville Island</i> Lights unlit
251/2015	Aus397 399 684 4622	<i>Buka Passage</i> Light unlit
79/2016	Aus520 4620 4621 AX04620U 04621S 04621U	<i>Cape Nelson</i> Light unlit
1029/2014	Aus379 647	<i>Caution Bay</i> Light beacon destroyed
166/2013	Aus388 4622	<i>Condor Point</i> Light unlit
748/2015	Aus673	<i>Dampier Strait</i> Light buoy off station
81/2016	Aus515 516 637 4621 AX04621S 04621U	<i>Kitava Island</i> Light unlit
164/2013	Aus628	<i>Nuakata Passage</i> Light beacon destroyed
963/2015	Aus621 622	<i>Port Moresby</i> Survey Operations
82/2016	Aus506 4604 4620 4621 AX04604U 04620U 04621S 04621U	<i>Rothery Passage</i> Light beacon unlit
83/2016	Aus376 377 378 379 502 505 506 507 508 621 623 647 840 4603 4604	<i>Uluma Reef to Gulf of Papua</i> Seismic survey

111(T)/2016 **AUSTRALIA - TEMPORARY AND PRELIMINARY NOTICES**
4620 4621 4622 AX04603U 04604U
04620U 04621S 04621U

<i>Notice</i>	<i>Charts affected</i>	<i>Locality and Subject</i>
1191/2014	Aus389 651 4622	<i>Unei Island</i> Light unlit

II

HYDROGRAPHIC REPORTS

NIL

NAVIGATION WARNINGS

The following radio messages have been received during the period to 14 January 2016. Signal copies of these messages may be destroyed. It is recommended that the reprint of Navigational Warnings should be kept in a file or a book divided into areas. Cancellation should be made on receipt of signals and reprints.

Rigs on location other than those listed in the latest Section III summary are the subject of Radio Navigational Warnings. Rigs in transit will not be the subject of Warnings.

AUSCOAST WARNING

- 336 Cancelled.
- 337 Drill rig *Atwood Eagle* in position 19° 32'.42 S 116° 10'.85 E. 2.5M clearance requested.
- 338 12 six metre yellow buoys, *Fl.3s*, deployed in the vicinity of 19° 54'.3 S 115° 16'.1 E. 2M clearance requested.

2016

- 001 8 six metre buoys, *Fl.3s*, deployed in the vicinity of 19° 40'.46 S 117° 21'.05 E. 2M clearance requested.
- 002 Cancelled.
- 003 Drill rig *Atwood Falcon* in position 21° 31'.80 S 114° 05'.15 E. 2.5M clearance requested.
- 004 Scientific equipment deployed 20 metres underwater in position 19° 55'.49 S 115° 23'.81 E.
- 005 Cancelled.
- 006 6 metre buoy, *Fl.3s*, in position 19° 48'.9 S 115° 21'.6 E.
- 007 Cancelled.
- 008 Special purpose vessel *Miclyn Endurance* conducting cable laying operations in an area bounded by 20° 01'.6 S to 20° 57'.5 S and 115° 35'.0 E to 116° 18'.0 E. 2.5M clearance requested.

NAVAREA X WARNINGS

2015

- 087 Cancelled.
- 088 Cancelled.
- 089 Cancelled.
- 090 Cancelled.
- 091 Cancelled.
- 092 Cancelled.
- 093 *Fugro Discovery*, *Fugro Equator* and *Havila Harmony* conducting underwater operations in an area bounded by 35° 43'.0 S to 40° 02'.0 S and 85° 04'.0 E to 91° 59'.0 E. 10M clearance requested.
- 094 Cancelled.

2016

- 001 Cancelled.

Navigational warnings in force as at 140001UTC JAN 16.

Auscoast

2015 295 298 306 309 323 326 329 333 335 337 338

2016 001 003 004 006 008

Navarea X

2015 093

Summary of mobile drilling rigs as at 140001UTC JAN 16.


Name	Position
Stena Clyde	12° 07'.00 S 130° 26'.00 E
Ensco 5006	13° 52'.80 S 123° 19'.00 E
Jack Bates	13° 54'.30 S 123° 09'.90 E
Noble Tom Prosser	18° 52'.81 S 118° 49'.32 E
Modec Venture 11	19° 16'.60 S 116° 36'.70 E
Atwood Eagle	19° 32'.42 S 116° 10'.85 E
Atwood Osprey	19° 48'.67 S 115° 17'.72 E
Ocean Monarch	20° 01'.80 S 115° 12'.10 E
Armada Claire	20° 03'.50 S 115° 11'.50 E
Atwood Falcon	21° 31'.80 S 114° 05'.15 E

NAVAREA XIV WARNINGS


Nil.

Navarea XIV warnings in force as at 140001UTC JAN 16.**2015 101**


To accompany Australian Notice to Mariners 45/2016

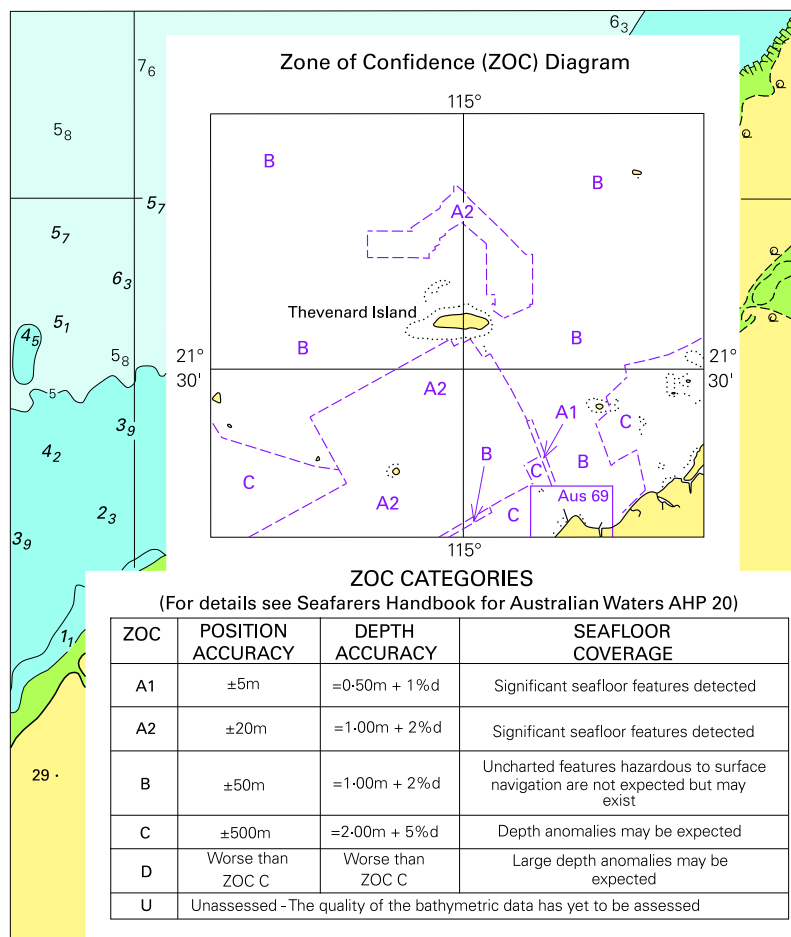

To accompany Australian Notice to Mariners 45/2016

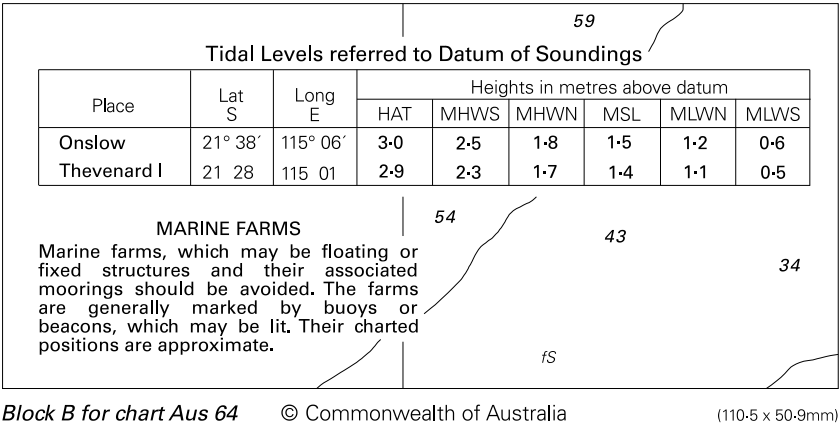

To accompany Australian Notice to Mariners 46/2016

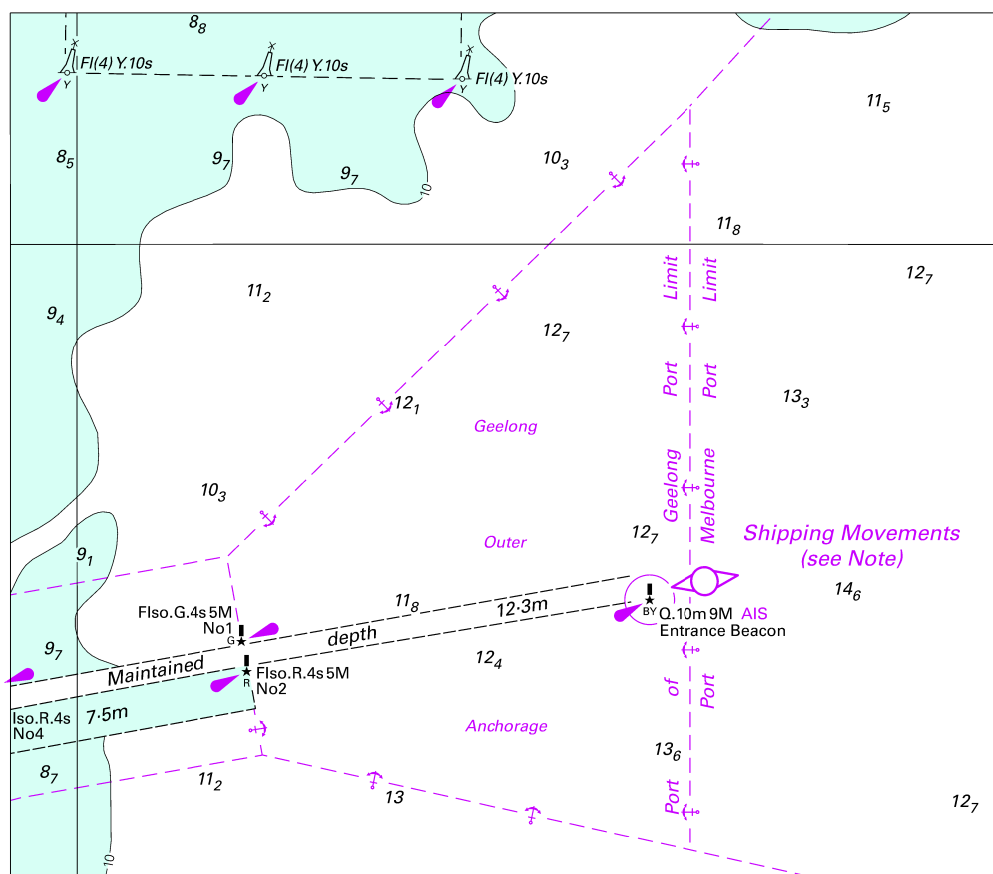


Block for Chart Aus 157

© Commonwealth of Australia 2016

(131.8 x 114.7mm)

To accompany Australian Notice to Mariners 47/2016

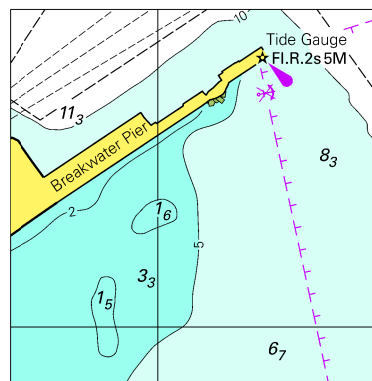

© Commonwealth of Australia 2016

Block for Chart Aus 154 (48.9 x 49.3mm)