



14 August 2015

Edition 16

Australian Notices to Mariners are the authority for correcting Australian Charts and Publications

AUSTRALIAN NOTICES TO MARINERS

Notices 858 - 911



Published fortnightly by the Australian Hydrographic Service

Commodore B.K. BRACE RAN
Hydrographer of Australia

SECTIONS.

- I. Australian Notices to Mariners, including blocks and notes.
- II. Hydrographic Reports.
- III. Navigational Warnings.

SUPPLEMENTS.

- I. Tracings
- II. Cumulative List of Australian Notices to Mariners.
- III. Cumulative List of Temporary and Preliminary Australian Notices to Mariners.
- IV. Temporary and Preliminary Notices in force.
- V. Amendments to Admiralty List of Lights and Fog Signals (Vol K), Radio Signals (NP 281(2), 282, 283(2), 285, 286(4)) and Sailing Directions (NP 9, 13, 14, 15, 33, 34, 35, 36, 39, 44, 51, 60, 61, 62, 100, 136).

© Commonwealth of Australia 2015

This work is copyright. Apart from any use permitted under the Copyright Act 1968, no part may be reproduced by any process, adapted, communicated or commercially exploited without prior written permission from The Commonwealth represented by the Australian Hydrographic Service.

IMPORTANT NOTICE

This edition of Notices to Mariners includes all significant information affecting AHS products which the AHS has become aware of since the last edition. All reasonable efforts have been made to ensure the accuracy and completeness of the information, including third party information, on which these updates are based. The AHS regards third parties from which it receives information as reliable, however the AHS cannot verify all such information and errors may therefore exist. The AHS does not accept liability for errors in third party information.

GENERAL INSTRUCTIONS

The substance of these notices should be inserted on the charts affected.

Bearings are referred to the true compass and are reckoned clockwise from North; those relating to lights are given as seen by an observer from seaward.

Positions quoted in notices relate to WGS84 which is the horizontal datum for all charts produced by the Australian Hydrographic Service.

The range quoted for a light is its nominal range.

Depths are with reference to the chart datum of each chart. Heights are above mean high water springs or mean higher high water, as appropriate.

The capital letter (P) or (T) after the number of any notice denotes a preliminary or temporary notice respectively, which are contained separately at the end of the permanent notices.

A star (*) adjacent to the number of a notice indicates that the notice is based on original information.

REPORTING OF DANGERS

Mariners are particularly requested to notify the AUSTRALIAN HYDROGRAPHIC SERVICE, Locked Bag 8801 Wollongong, NSW 2500 (Fax 02-4223 6599, e-mail Hydro.NTM@defence.gov.au or, alternatively by filling in and submitting the [Hydrographic Notes](#) forms located on the web site – www.hydro.gov.au), immediately on the discovery of new dangers or suspected dangers to navigation. For changes or defects in aids to navigation notify AusSAR (Fax 02-6230 6868 or email rccaus@amsa.gov.au).

AUTHORISED USE

Copies of Australian notices are available free of charge from the Australian Hydrographic Service (AHS) website (www.hydro.gov.au) and through the eNotices (email) service (www.hydro.gov.au/enotices/enotices.htm).

Individual Notices may be copied for the purpose of inserting Notice substance on official charts and publications. Paper copies may be printed by chart agents and distributed to customers on a cost recovery basis. Participating chart agents are listed on the AHS website as providing a 'Paper Notices to Mariners' service (www.hydro.gov.au/prodserv/distributors/distributors.htm). Copies of the notices may not be sold for profit without prior written agreement.

NUMERICAL INDEX OF NOTICES TO MARINERS

Edition No 16

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
858	Aus 254
859	Amendment to Australian Notice to Mariners No 2
860	Aus 204, 215, 217, AX 00215T
861	Aus 200, 202, AX 00202T
862	Aus 249, 251, AX 00249S
863	Aus 242
864	Aus 246
865	Aus 250
866	Aus 252
867	Aus 621
868	Aus 521
869	Aus 647, 648
870	Aus 543, 666
871	Aus 15
872	Aus 328, 329, 4723, 4725, INT 723, 725, AX 04723U
873	Aus 607
874	Aus 777
875	Aus 181, 182
876	Aus 141
877	Aus 169
878	Aus 167
879	Aus 167
880(T)	Aus 222
881(T)	Aus 222
882(T)	Aus 806
883(T)	Aus 207, 208, 809, AX 00809S
884(T)	Aus 241
885(T)	Aus 249, AX 00249S
886(T)	Aus 235, 236, 237, 238, 814, 815
887(T)	Aus 260, 367, 822, AX 00260S, 00260T, 00367S, 00822S
888(T)	Aus 28
889(T)	Aus 26, 28, AX 00026T
890(T)	Aus 26, 28, AX 00026T
891(T)	Aus 26, 28, AX 00026T
892(T)	Aus 26, 27, AX 00026T
893(T)	Aus 26, 28, AX 00026T
894(T)	Aus 28
895(T)	Aus 314, 319, 4721, 4722, INT 721, 722, AX 00314U, 00319S, 00319U, 04721U, 04722U
896(T)	Aus 312, 315, AX 00312U, 00315U
897(T)	Aus 66
898(T)	Aus 319, 320, AX 00319S, 00319U, 00320S
899(T)	Aus 45, 323, 733
900(T)	Aus 328
901(T)	Aus 84, 329, 331, 332, 333, 745, 746, 748, 749, 751, 752
902(T)	Aus 328
903(T)	Aus 328
904(T)	Aus 328
905(T)	Aus 154
906(T)	Aus 154
907(T)	Aus 143, 158
908(T)	Aus 143, 144, 158
909(T)	Aus 357, 487, 4644, INT 644
910(T)	Aus 169
911(T)	Aus 177

NUMERICAL INDEX OF CHARTS AFFECTED

Edition No 16

Aus Chart	Notices
Aus 15	871
Aus 26	889(T), 890(T), 891(T), 892(T), 893(T)
Aus 27	892(T)
Aus 28	888(T), 889(T), 890(T), 891(T), 893(T), 894(T)
Aus 45	899(T)
Aus 66	897(T)
Aus 84	901(T)
Aus 141	876
Aus 143	907(T), 908(T)
Aus 144	908(T)
Aus 154	905(T), 906(T)
Aus 158	907(T), 908(T)
Aus 167	878, 879
Aus 169	877, 910(T)
Aus 177	911(T)
Aus 181	875
Aus 182	875
Aus 200	861
Aus 202	861
Aus 204	860
Aus 207	883(T)
Aus 208	883(T)
Aus 215	860
Aus 217	860
Aus 222	880(T), 881(T)
Aus 235	886(T)
Aus 236	886(T)
Aus 237	886(T)
Aus 238	886(T)
Aus 241	884(T)
Aus 242	863
Aus 246	864
Aus 249	862, 885(T)
Aus 250	865
Aus 251	862
Aus 252	866
Aus 254	858
Aus 260	887(T)
Aus 312	896(T)
Aus 314	895(T)
Aus 315	896(T)
Aus 319	895(T), 898(T)
Aus 320	898(T)
Aus 323	899(T)
Aus 328	872, 900(T), 902(T), 903(T), 904(T)
Aus 329	872, 901(T)
Aus 331	901(T)
Aus 332	901(T)
Aus 333	901(T)
Aus 357	909(T)
Aus 367	887(T)
Aus 487	909(T)
Aus 521	868
Aus 543	870

Aus Chart	Notices
Aus 607	873
Aus 621	867
Aus 647	869
Aus 648	869
Aus 666	870
Aus 733	899(T)
Aus 745	901(T)
Aus 746	901(T)
Aus 748	901(T)
Aus 749	901(T)
Aus 751	901(T)
Aus 752	901(T)
Aus 777	874
Aus 806	882(T)
Aus 809	883(T)
Aus 814	886(T)
Aus 815	886(T)
Aus 822	887(T)
Aus 4644	909(T)
Aus 4721	895(T)
Aus 4722	895(T)
Aus 4723	872
Aus 4725	872
AX 00026T	889(T), 890(T), 891(T), 892(T), 893(T)
AX 00202T	861
AX 00215T	860
AX 00249S	862, 885(T)
AX 00260S	887(T)
AX 00260T	887(T)
AX 00312U	896(T)
AX 00314U	895(T)
AX 00315U	896(T)
AX 00319S	895(T), 898(T)
AX 00319U	895(T), 898(T)
AX 00320S	898(T)
AX 00367S	887(T)
AX 00809S	883(T)
AX 00822S	887(T)
AX 04721U	895(T)
AX 04722U	895(T)
AX 04723U	872

INT Chart	Notices
INT 644	909(T)
INT 721	895(T)
INT 722	895(T)
INT 723	872
INT 725	872

858 AUSTRALIA - Products - New Charts, New Editions, Withdrawn Charts

Australian Hydrographic Service (AA826434, AA826457)

New Charts

Chart	Title and Geographical limits	Scale	Publication Date	Remarks
NIL				

New Editions and Withdrawn Charts

Chart	Title	Scale	Publication Date	Remarks
Aus 254	Australia - East Coast - Queensland -		14 August 2015	New edition incorporating new bathymetric data and general updating throughout.
Edition 3	Plans in Whitsundays			Chart Aus 254 Edition 2 dated 10 Jun 2005 is now superseded and must be withdrawn from use.
	Plans:			
	Stonehaven Anchorage	1 : 12 500		
	Lindeman Island	1 : 37 500		
	Hook Reef	1 : 75 000		
	Fitzalan Passage	1 : 25 000		
	Hamilton and Dent Islands	1 : 15 000		

New Miscellaneous Editions

Chart	Title	Scale	Publication Date	Remarks
AZ00006G	Western Australia Exercise Area - GOP	1 : 900 000	14 August 2015	Fleet use only
AZA0006G	Western Australia Exercise Area - GOP (Large Scale)	1 : 450 000	14 August 2015	Fleet use only

Chart permanently withdrawn

Charts listed above as withdrawn no longer meet chart carriage requirements and should be marked as "superseded" and replaced with the new chart/ new edition listed prior to passage through the area covered by the new chart.

When placing orders with a chart agent between notice of forthcoming edition and its publication, mariners should advise whether their order pertains to the current edition or the new edition.

For further details refer to the AHS website at www.hydro.gov.au for new edition and new chart stock arrival information.

When placing orders with a chart agent, mariners should advise whether their order pertains to the current edition or the new edition.

859 AUSTRALIA - Product - Amendment to Australian Notice to Mariners No 2

Australian Hydrographic Service (AA826456)

Page 14

Amend DPM (Singapore) Pte Ltd details to read:

DPM (Singapore) Pte Ltd

2 Boon Leat Terrace

#05-02/03/04 Harbourside Building 2

Singapore 119844

Telephone

(65) 6270 4060

C,NtM

Fax

(65) 6276 3858

Email

sales@gnsworldwide.com

Website

www.gnsworldwide.com

860* AUSTRALIA - NEW SOUTH WALES - Pittwater - Nav aids
NSW Roads and Maritime Services (AA824158)

Aus 204 [711/2015]

Insert	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 37'.91 S	151° 18'.33 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 36'.73 S	151° 18'.89 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 36'.03 S	151° 18'.31 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 37'.98 S	151° 17'.47 E
	special purpose spar buoy, without topmark	33° 37'.41 S	151° 18'.00 E
Move	buoy	33° 35'.61 S	151° 18'.43 E
	to	33° 35'.74 S	151° 18'.36 E
	buoy	33° 37'.51 S	151° 17'.70 E
	to	33° 37'.58 S	151° 17'.63 E
Delete	buoy	33° 37'.9 S	151° 18'.3 E
	buoy	33° 36'.2 S	151° 18'.5 E
	buoy	33° 37'.8 S	151° 17'.5 E
	buoy	33° 36'.6 S	151° 19'.0 E
	depth, 14 ₆ m	33° 35'.7 S	151° 18'.4 E
	depth, 16 ₄ m	33° 37'.9 S	151° 17'.5 E

Aus 215 [462/2015]

Insert	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 37'.909 S	151° 18'.331 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 36'.728 S	151° 18'.888 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 36'.031 S	151° 18'.314 E
	orange spar light buoy, <i>Fl. Y. 5s</i> , without topmark	33° 37'.982 S	151° 17'.470 E
	special purpose spar buoy, without topmark	33° 37'.411 S	151° 18'.004 E
Move	buoy	33° 37'.506 S	151° 18'.690 E
	to	33° 37'.557 S	151° 18'.611 E
	buoy	33° 35'.606 S	151° 18'.425 E
	to	33° 35'.739 S	151° 18'.362 E
	buoy	33° 37'.512 S	151° 17'.701 E
	to	33° 37'.582 S	151° 17'.630 E
	buoy	33° 34'.173 S	151° 15'.677 E
	to	33° 34'.010 S	151° 15'.960 E
Delete	buoy	33° 37'.88 S	151° 18'.33 E
	buoy	33° 36'.24 S	151° 18'.45 E
	buoy	33° 37'.83 S	151° 17'.45 E

Aus 217 [765/2014]

Move	buoy	33° 34'.173 S	151° 15'.677 E
	to	33° 34'.010 S	151° 15'.960 E

AX 00215T [462/2015]

Move	buoy	33° 34'.173 S	151° 15'.677 E
	to	33° 34'.010 S	151° 15'.960 E
Delete	buoy	33° 35'.61 S	151° 18'.43 E

861* AUSTRALIA - NEW SOUTH WALES - Port Jackson - Balmain - Infrastructure; light
 NSW Roads and Maritime Services (SIRF2015000269), (SIRF2015000271)

Aus 200 [663/2015]

Insert	light, <i>Fl.G.3s</i>	33° 51'.402 S	151° 11'.775 E
	continuous line, between	33° 51'.424 S	151° 11'.752 E
		33° 51'.428 S	151° 11'.771 E
		33° 51'.402 S	151° 11'.775 E

Aus 202 [663/2015]

Insert	continuous line, between	33° 51'.425 S	151° 11'.752 E
		33° 51'.427 S	151° 11'.766 E
		33° 51'.417 S	151° 11'.768 E
	continuous line, between	33° 51'.418 S	151° 11'.773 E
		33° 51'.417 S	151° 11'.765 E
		33° 51'.400 S	151° 11'.768 E
		33° 51'.401 S	151° 11'.776 E
		33° 51'.418 S	151° 11'.773 E
	light, <i>Fl.G.3s 2M</i>	33° 51'.402 S	151° 11'.775 E

AX 00202T [663/2015]

Insert	continuous line, between	33° 51'.425 S	151° 11'.752 E
		33° 51'.427 S	151° 11'.766 E
		33° 51'.417 S	151° 11'.768 E
	continuous line, between	33° 51'.418 S	151° 11'.773 E
		33° 51'.417 S	151° 11'.765 E
		33° 51'.400 S	151° 11'.768 E
		33° 51'.401 S	151° 11'.776 E
		33° 51'.418 S	151° 11'.773 E
	light, <i>Fl.G.3s 2M</i>	33° 51'.402 S	151° 11'.775 E

862* AUSTRALIA - QUEENSLAND - Bailey Islet - light buoy
 Maritime Safety Queensland Notice 226/2015 (SIRF2015000260)

Aus 249 [605/2015]

Move	light buoy	21° 02'.34 S	149° 32'.69 E
	to	21° 02'.36 S	149° 32'.85 E

Aus 251 [1160/2014]

Move	light buoy	21° 02'.34 S	149° 32'.69 E
	to	21° 02'.36 S	149° 32'.85 E

AX 00249S [605/2015]

Move	light buoy	21° 02'.34 S	149° 32'.69 E
	to	21° 02'.36 S	149° 32'.85 E

863* AUSTRALIA - QUEENSLAND - Bundaberg - Light buoys
Maritime Safety Queensland Notice 229/2015 (AA824869, AA825237)

Aus 242 (plan, Port Bundaberg) [161/2015]

Move	light buoy	24° 46'.05 S	152° 22'.76 E
	to	24° 46'.045 S	152° 22'.723 E
	light buoy	24° 46'.18 S	152° 22'.72 E
	to	24° 46'.263 S	152° 22'.726 E
	light buoy	24° 46'.25 S	152° 22'.74 E
	to	24° 46'.434 S	152° 22'.784 E
Delete	light buoy	24° 46'.29 S	152° 22'.77 E
	light buoy	24° 46'.31 S	152° 22'.82 E

Aus 242 (plan, Burnett River (Northern Section)) [161/2015]

Move	light buoy	24° 46'.05 S	152° 22'.76 E
	to	24° 46'.045 S	152° 22'.723 E
	light buoy	24° 46'.18 S	152° 22'.72 E
	to	24° 46'.263 S	152° 22'.726 E
	light buoy	24° 46'.25 S	152° 22'.74 E
	to	24° 46'.434 S	152° 22'.784 E
Delete	light buoy	24° 46'.29 S	152° 22'.77 E
	light buoy	24° 46'.31 S	152° 22'.82 E

864* AUSTRALIA - QUEENSLAND - Gladstone - light buoy
Maritime Safety Queensland Notice 226/2015 (SIRF2015000260)

Aus 246 [NE 22/5/2015]

Move	light buoy	23° 53'.73 S	151° 30'.13 E
	to	23° 53'.683 S	151° 30'.084 E

865* AUSTRALIA - QUEENSLAND - Hay Point - Light buoy
Maritime Safety Queensland Notice 226/2015 (SIRF2015000260)

Aus 250 (plan, Hay Point) [715/2015]

Move	light buoy	21° 16'.286 S	149° 18'.616 E
	to	21° 16'.332 S	149° 18'.696 E

866* AUSTRALIA - QUEENSLAND - Whitsunday Group - Shaw Island - Depths
HS White (DHDB 1527819)

Aus 252 [718/2015]

Insert	accompanying block	20° 31'.00 S	149° 05'.00 E
--------	--------------------	--------------	---------------

867* PAPUA NEW GUINEA - Bootless Inlet - Navais
PNG NMSA (SIRF2015000365)

Aus 621 [721/2015]

Delete	beacon	9° 29'.19 S	147° 14'.78 E
	beacon	9° 29'.23 S	147° 14'.76 E
	beacon	9° 29'.54 S	147° 15'.35 E
	beacon	9° 29'.68 S	147° 15'.21 E
	beacon	9° 29'.84 S	147° 15'.74 E
	beacon	9° 29'.91 S	147° 15'.80 E
	beacon	9° 30'.03 S	147° 15'.83 E
	beacon	9° 30'.16 S	147° 15'.79 E
	beacon	9° 30'.14 S	147° 16'.06 E
	beacon	9° 30'.73 S	147° 16'.92 E
	beacon	9° 30'.85 S	147° 16'.90 E
	beacon	9° 30'.96 S	147° 16'.88 E

868* PAPUA NEW GUINEA - Cape Killerton - Nav aids
PNG NMSA (SIRF2015000364)

Aus 521 [1083/2013]

Delete	beacon	8° 37'.1 S	148° 20'.7 E
	beacon	8° 37'.1 S	148° 20'.9 E
	beacon with legend 2 Bns	8° 37'.2 S	148° 20'.6 E
	dashed and continuous line with legend 168·3°, emanating from beacon	8° 37'.2 S	148° 20'.6 E

869* PAPUA NEW GUINEA - Caution Bay - Light
PNG NMSA (SIRF2015000382)

Aus 647 [361/2014]

Amend	light to <i>Fl.Bu.2s RL2</i>	9° 18'.0 S	146° 58'.2 E
-------	------------------------------	------------	--------------

Aus 648 [769/2014]

Amend	light to <i>Fl.Bu.2s RL2</i>	9° 17'.98 S	146° 58'.19 E
-------	------------------------------	-------------	---------------

870* PAPUA NEW GUINEA - Nusa Channel - Kavieng Harbour to Wadei Island - Nav aids
National Maritime Safety Authority PNG (AA823275)

Aus 543 [411/2015]

Amend	bearing to <i>035·1°</i>	2° 36'.7 S	150° 46'.1 E
-------	--------------------------	------------	--------------

Aus 666 [411/2015]

Insert	a dashed line in a direction 215·1° for a distance of 550m, thence a continuous line for 4450m, with legend <i>035·1°</i> , emanating from beacon	2° 34'.91 S	150° 47'.45 E
--------	---	-------------	---------------

Amend	light range to <i>4M</i>	2° 35'.5 S	150° 47'.1 E
	light description to <i>Fl(2)G.8s 7m 3M</i>	2° 39'.4 S	150° 37'.7 E

Delete	light sector emanating from light beacon	2° 39'.4 S	150° 37'.7 E
	dashed and continuous line with legend, emanating from beacon	2° 34'.9 S	150° 47'.5 E

Aus 666 (plan, Kavieng Harbour) [411/2015]

Insert	a dashed line in a direction 215·1° for a distance of 550m, thence a continuous line for 4450m, with legend <i>035·1°</i> , emanating from beacon	2° 34'.91 S	150° 47'.45 E
--------	---	-------------	---------------

Amend	light range to <i>4M</i>	2° 35'.55 S	150° 47'.09 E
-------	--------------------------	-------------	---------------

Delete	dashed and continuous line with legend, emanating from beacon	2° 34'.91 S	150° 47'.45 E
--------	---	-------------	---------------

871* AUSTRALIA - NORTHERN TERRITORY - Gove Harbour - Snapper Shoal - Light buoy
Former Notice - 642(T)/2015 is cancelled
Rio Tinto (AA825125)

Aus 15 (plan, Gove Harbour) [469/2015]

Move	light buoy	12° 11'.04 S	136° 39'.29 E
	to	12° 11'.027 S	136° 39'.423 E

872* AUSTRALIA - WESTERN AUSTRALIA - North West Cape - Obstruction northwestwards

BHP Billiton Petroleum Pty Ltd (AA823385, AA823390)

Aus 328 [731/2015]Substitute depth, 40m, enclosed by danger circle with legend *Obstn*, for FPSO 21° 26'.9 S 113° 49'.5 E

Delete cautionary area, with legend Cautionary Area (see Note), centred on 21° 26'.9 S 113° 49'.5 E

Aus 329 [169/2015]Substitute depth, 40m, enclosed by danger circle with legend *Obstn*, for FPSO 21° 26'.9 S 113° 49'.5 E

Delete cautionary area, with legend Cautionary Area (see Note), centred on 21° 26'.9 S 113° 49'.5 E

Aus 4723 (INT 723) [831/2015]Substitute depth, 40m, enclosed by danger circle with legend *Obstn*, for FPSO 21° 26'.9 S 113° 49'.5 E**Aus 4725 (INT 725) [580/2015]**Substitute depth, 40m, enclosed by danger circle with legend *Obstn*, for FPSO 21° 26'.9 S 113° 49'.5 E**AX 04723U [831/2015]**Substitute depth, 40m, enclosed by danger circle with legend *Obstn*, for FPSO 21° 26'.9 S 113° 49'.5 E**873* INDIAN OCEAN - Cocos Islands - Wreck**

Australian Hydrographic Service (AA813326), Department of the Environment (AA824829)

Aus 607 [NE 9/8/2013]Insert depth, 5m, enclosed by danger circle with legend *Wk* 12° 06'.094 S 96° 51'.578 E**874* AUSTRALIA - SOUTH AUSTRALIA - Walrus Rock - Beacon**

Department of Transport, Energy and Infrastructure SA (AA294755)

Aus 777 [348/2015]Move beacon 33° 59'.44 S 137° 29'.93 E
to 33° 59'.60 S 137° 29'.87 E**875* AUSTRALIA - VICTORIA - Port Albert - Light beacon**

Gippsland Ports Notice 138/2015 (AA824863)

Aus 181 [672/2015]Substitute port lateral light beacon, *LFl.R.6s 4M*, with topmark, for light beacon 38° 44'.2 S 146° 39'.9 E**Aus 182 (plan, Approaches to Port Albert) [834/2015]**Substitute port lateral light beacon, *LFl.R.6s 8m 4M*, with topmark, for light beacon 38° 44'.16 S 146° 39'.91 E**876* AUSTRALIA - VICTORIA - Warrnambool - Lady Bay - Light buoys**

Transport Safety Victoria Notice 141/2015 (AA825254)

Aus 141 [1209/2013]Insert special purpose spar light buoy, *Fl.Y.5s*, without topmark 38° 23'.80 S 142° 29'.34 E**Aus 141 (plan, Warrnambool) [1209/2013]**Insert special purpose spar light buoy, *Fl.Y.5s*, without topmark 38° 23'.796 S 142° 29'.337 E
special purpose spar light buoy, *Fl.Y.5s*, without topmark 38° 23'.861 S 142° 28'.955 E
special purpose spar light buoy, *Fl.Y.5s*, without topmark 38° 23'.988 S 142° 28'.682 E
special purpose conical light buoy, *Fl.Y.5s*, with topmark 38° 23'.931 S 142° 28'.786 E

Delete depth, 6,m 38° 23'.85 S 142° 28'.96 E

877* AUSTRALIA - TASMANIA - Georges Bay - Wreck; buoy
 MAST (AA824658)

Aus 169 (plan, Georges Bay) [624/2015]

Insert	depth, 1 ₃ m, enclosed by danger circle with legend <i>Wk</i>	41° 16'.237 S	148° 20'.072 E
	out of position blue and yellow conical buoy, without topmark	41° 16'.237 S	148° 20'.072 E
Delete	depth, 3 ₁ m	41° 16'.27 S	148° 20'.10 E

878* AUSTRALIA - TASMANIA - Long Reach - Plan withdrawn
 Australian Hydrographic Service (AA824874)

Aus 167 [1009/2014]

Amend	legend in border to <i>Adjoining Chart Aus 168</i>	41° 08'.5 S	146° 53'.8 E
-------	--	-------------	--------------

Aus 167 (inset, Long Reach) [1009/2014]

Delete	plan, LONG REACH	41° 09'.00 S	146° 55'.00 E
--------	------------------	--------------	---------------

879* AUSTRALIA - TASMANIA - Port Dalrymple - Light beacon
 Australian Hydrographic Service (AA35988)

Aus 167 [878/2015]

Amend	light to Q(2)R.5s	41° 08'.76 S	146° 50'.77 E
-------	-------------------	--------------	---------------

Aus 167 (plan, Bell Bay) [878/2015]

Amend	light to Q(2)R.5s	41° 08'.76 S	146° 50'.77 E
-------	-------------------	--------------	---------------

880(T)/2015 AUSTRALIA - NEW SOUTH WALES - Clarence River - Yamba - Harbour works*Date* - Until 31 December 2015

Port of Clarence River (Yamba) Notice 007(T)/2015 (SIRF2015000326)

Harbour works associated with the remediation of the north breakwater are being conducted at the entrance of Clarence River, (29° 25'.47 S 153° 22'.06 E)

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 222

881(T)/2015 AUSTRALIA - NEW SOUTH WALES - Clarence River - Yamba - Harbour works*Date* - Until 15 November 2015

Port of Clarence River (Yamba) Notice 8(T)/2015 (SIRF2015000458)

Harbour works associated with the construction of a cofferdam and diffuser are being conducted in position 29° 25'.37 S 153° 21'.18 E.

Works will be marked by lights, Q.Y.

Vessels will monitor VHF Ch 16 and Ch 9.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 222

882(T)/2015 AUSTRALIA - NEW SOUTH WALES - Green Cape - Light buoy off station

Manly Hydraulics Laboratory (SIRF2015000459)

The special light buoy, *Fl(5)Y.20s* (37° 15'.91 S 150° 11'.59 E) is off station.

Chart temporarily affected - Aus 806

883(T)/2015 AUSTRALIA - NEW SOUTH WALES - Newcastle - Depth information

Former Notice - 839(T)/2015 is cancelled
Newcastle Port Corporation (AA825261)

Available depths as at 31 July 2015:

<i>Berth</i>	<i>Metres</i>	<i>Remarks</i>
Eastern Basin 1	11.5	
Eastern Basin 2 North of Ch 450	11.6	
Eastern Basin 2 South of Ch 450	11.6	
Western Basin 3	11.6	
* Western Basin 4	11.5	
Channel Berth	9.6	
Dyke 1	12.8	
Dyke 2	12.8	
Dyke 4	16.3	
Dyke 5	16.2	
Dyke 6	5.3	
Mayfield 4 Ch 27 to 266	12.8	
BHP Wharf 6 to Ch 1050	7.3	
Kooragang 2	11.6	
Kooragang 2 North Dolphin Ch 182 to 243	11.6	
Kooragang 2 South Dolphin Ch -92 to 00	11.6	
Kooragang 3 Ch -40 to 00	13.2	
Kooragang 3 Ch 00 to 190	13.4	
Kooragang 3 Ch 190 to 220	13.2	
* Kooragang 4	16.5	
* Kooragang 5	16.5	
* Kooragang 6	16.5	
* Kooragang 7	16.3	
Kooragang 8	16.2	
Kooragang 9	16.2	
Kooragang 10	16.3	
Throsby 1 Ch 850 to 1030	8.9	
Carrington Wharf		To be sounded as and when required
Foreshore Park Berth	5.9	
Elgo Wharf		To be sounded as and when required
<i>Channels</i>		
Entrance Approach	17.4	
Entrance Channel (18.0m)	17.7	
Entrance Channel (17.4m)	17.4	
Entrance Channel (16.8m)	16.8	
Entrance Channel (16.2m)	16.2	
Entrance Channel to Horseshoe	15.2	
Horseshoe	15.2	
Steelworks Channel to Swinging Basin	15.2	
Swinging Basin	15.2	
* Hunter River South Arm (Kooragang 6 to buoy 16)	15.2	
Hunter River South Arm (buoy 16 to buoy 20)	15.1	
Basin Cutting	12.6	
Basin Area to Eastern & Western Basin Berths	12.7	
Basin Area to Throsby 1	9.2	
Stockton Crossing	3.6	
* Indicates new or revised entry.		

Chart temporarily affected - Aus 207 - Aus 208 - Aus 809 - AX 00809S

884(T)/2015 AUSTRALIA - QUEENSLAND - Great Sandy Strait - Urangan - Dredging operations completed

Former Notice - 185(T)/2015 is cancelled
Australian Hydrographic Service (SIRF2015000479)

Cancel this notice on receipt.

Chart formerly affected - Aus 241

885(T)/2015 AUSTRALIA - QUEENSLAND - Hay point - Oceanographic observations

Date - Until 25 September 2015

Maritime Safety Queensland Notice 236/2015 (SIRF2015000474)

MV *Delphi* will be conducting oceanographic observations in the vicinity of the offshore spoil ground (21° 11'.82 S 149° 18'.58 E).

The vessel will monitor VHF Ch 10 and Ch 16.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 249 - AX 00249S

886(T)/2015 AUSTRALIA - QUEENSLAND - Moreton Bay - Brisbane River - Depth information

Former Notice - 842(T)/2015 is cancelled

Brisbane Port Corporation (AA825260, SIRF2015000436)

Available depths and under keel clearances (UKC) at 10 August 2015:

<i>Berth</i>	<i>Metres</i>	<i>Remarks</i>
Fisherman Islands No12	13.4	
Fisherman Islands No11	14.0	
Fisherman Islands No10	13.8	
Fisherman Islands No9	13.9	
Fisherman Islands No8	14.2	
Fisherman Islands No7	14.1	
* Fisherman Islands No6	14.1	
Fisherman Islands No5	14.0	
* Fisherman Islands No4	13.9	
Fisherman Islands No3	14.0	
* Fisherman Islands No2	14.0	
Fisherman Islands No1	14.1	
Fisherman Islands Grain and Woodchip	13.2	
Caltex Fisherman Islands	14.3	
Fisherman Islands Coal	13.8	
* Fisherman Islands General Purpose	10.6	
BP Luggage Point	13.7	
Caltex Products	10.3	
* Cement Australia Co Wharf	9.5	
BP Products	10.7	
Viva Energy	10.9	
Graincorp Liquid Terminal	10.7	
Incitec North	10.0	
Incitec South	10.4	
* Pinkenba 1	10.1	
* Pinkenba 2	10.1	
Riverside Marina	-	
Sugar Terminal	9.9	
Cairncross Fitting Out Wharf	7.1	
Cairncross Breasting Wharf	4.4	
Brisbane Naval Wharf	4.3	
* Maritime No1	8.6	
* Hamilton No4	10.1	
Hamilton No1	8.8	
Brisbane Cruise Ship Terminal	8.9	
	<i>Metres</i>	<i>UKC/Remarks</i>
<i>Moreton Bay:</i>		
North West Channel	15.0	2.3 (280m width)
North West Bypass Channel	9.2	1.6
Spitfire Channel	15.0	1.5 (600m width)
East Knoll Bypass Channel	6.0	1.4
East Channel	15.0	1.5 (300m width from western side)
Main Channel (M8 - M9)	10.0	1.8
Entrance Channel (E5 - EBCN)	14.7	1.5
<i>Brisbane River:</i>		
Outer Bar Cutting	14.0	1.46
Inner Bar Cutting	14.0	1.46
* Fisherman Islands Swing Basin	14.0	1.3
* Fisherman Islands Swing Basin (11.5)	11.5	0.6
River	9.1	0.6 / 0.9 (draft/tide)
Cement Australia Swing Basin	9.1	0.6 / 0.9 (draft/tide)
Pinkenba Swing Basin	9.1	0.6 / 0.9 (draft/tide)
* Hamilton Swing Basin	8.4	0.6 / 0.9 (draft/tide)
* Indicates new or revised entry.		

Chart temporarily affected - Aus 235 - Aus 236 - Aus 237 - Aus 238 - Aus 814 - Aus 815

887(T)/2015 AUSTRALIA - QUEENSLAND - Shoalwater Bay - Live firing*Date* - Until 6 September 2015

Maritime Safety Queensland Notice 214(T)/2015 (AA822571)

Live firing activities will be conducted within a 3M radius of position 22° 22'.58 S 150° 30'.40 E from 22 August to 6 September 2015.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 260 - Aus 367 - Aus 822 - AX 00260S - AX 00260T - AX 00367S - AX 00822S

888(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - East Arm - Light beacon restored*Former Notice* - 552(T)/2015 is cancelled

Darwin Port Corporation Notice 094(T)/2015 (SIRF2015000381)

Cancel this notice on receipt.

Chart formerly affected - Aus 28

889(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - East Arm - Light beacon restored*Former Notice* - 595(T)/2015 is cancelled

Darwin Port Corporation Notice 094(T)/2015 (SIRF2015000381)

Cancel this notice on receipt.

Chart formerly affected - Aus 26 - Aus 28 - AX 00026T

890(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - Hudson Creek - Light beacon restored*Former Notice* - 594(T)/2015 is cancelled

Darwin Port Corporation Notice 094(T)/2015 (SIRF2015000381)

Cancel this notice on receipt.

Chart formerly affected - Aus 26 - Aus 28 - AX 00026T

891(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - Hudson Creek - Light buoy restored*Former Notice* - 641(T)/2015 is cancelled

Darwin Port Corporation Notice 094(T)/2015 (SIRF2015000381)

Cancel this notice on receipt.

Chart formerly affected - Aus 26 - Aus 28 - AX 00026T

892(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - Middle Arm - Pipeline; buoys

Department of Transport NT Notices 88(T)/2015, 98(T)/2015 (SIRF2015000379, SIRF2015000395)

A pipeline has been established between the coastline and 12° 32'.11 S 130° 51'.95 E. The end is marked by special light buoys, Q.Y.

A lit mooring buoy, Q.Y, exists in position 12° 32'.11 S 130° 51'.97 E

Chart temporarily affected - Aus 26 - Aus 27 - AX 00026T

893(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - East Arm - Scientific instruments

Northern Territory Government Notice 97(T)/2015 (SIRF2015000387)

Special light buoys, Q. Y, exist as follows;

12° 29'.66 S 130° 55'.36 E
 12° 30'.48 S 130° 53'.15 E
 12° 30'.73 S 130° 54'.29 E
 12° 30'.11 S 130° 55'.59 E
 12° 30'.32 S 130° 55'.41 E
 12° 30'.51 S 130° 55'.95 E
 12° 31'.09 S 130° 55'.95 E
 12° 31'.97 S 130° 56'.39 E.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 26 - Aus 28 - AX 00026T

894(T)/2015 AUSTRALIA - NORTHERN TERRITORY - East Arm - Lights

Department of Transport NT Notice96(T)/2015 (SIRF2015000386)

Lights, Q. Y, exist in the following positions:

12° 30'.636 S 130° 54'.439 E
 12° 30'.607 S 130° 54'.491 E
 12° 30'.604 S 130° 54'.503 E
 12° 30'.603 S 130° 54'.529 E
 12° 30'.598 S 130° 54'.542 E
 12° 30'.607 S 130° 54'.601 E
 12° 30'.591 S 130° 54'.696 E
 12° 30'.557 S 130° 54'.762 E
 12° 30'.554 S 130° 54'.779 E
 12° 30'.549 S 130° 54'.806 E
 12° 30'.545 S 130° 54'.827 E
 12° 30'.553 S 130° 54'.908 E.

Chart temporarily affected - Aus 28

895(T)/2015 AUSTRALIA - TIMOR SEA - Ashmore Reef - Seismic survey completed

Former Notice - 792(T)/2015 is cancelled

Spectrum Geo Pty Ltd (AA822882)

Cancel this notice on receipt.

Chart formerly affected - Aus 314 - Aus 319 - Aus 4721 (INT 721) - Aus 4722 (INT 722) - AX 00314U - AX 00319S - AX 00319U - AX 04721U - AX 04722U

896(T)/2015 AUSTRALIA - TIMOR SEA - Sahul Banks - Mooring buoys; seismic survey southeastwards

Date - Until 30 November 2015

ConocoPhillips Australia (SIRF2015000375, SIRF2015000377, SIRF2015000435)

Mooring buoys have been withdrawn from the following positions:

11° 05'.33 S 126° 39'.83 E

11° 05'.30 S 126° 36'.80 E.

Lit yellow mooring buoys, *Fl(2)Y.10s*, exist as follows:

11° 03'.90 S 126° 52'.30 E

11° 05'.25 S 126° 52'.30 E.

MV *Ramform Sovereign* with a 5500m towed array, and support vessels *Unlimited* and *Thor Alpha* will be conducting a survey from 10 September 2015 in the area bounded by the following positions:

10° 56'.69 S 126° 39'.06 E

10° 58'.33 S 126° 45'.92 E

11° 00'.92 S 126° 51'.45 E

11° 07'.15 S 126° 51'.40 E

11° 10'.09 S 126° 47'.23 E

11° 10'.82 S 126° 42'.26 E

11° 10'.78 S 126° 36'.49 E

11° 09'.46 S 126° 31'.28 E

11° 03'.52 S 126° 27'.55 E

10° 59'.64 S 126° 07'.58 E

10° 56'.67 S 126° 35'.07 E

Mariners are advised to navigate with caution. 4M clearance requested.

Chart temporarily affected - Aus 312 - Aus 315 - AX 00312U - AX 00315U**897(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Town Point - Depth information**

Chevron Australia Pty Ltd Notice 14/2015 (SIRF2015000348)

Available depths as at 05 August 2015:

	Metres	Remarks
* Heavy Lift Facility (HLF)	7.0	
* Indicates new or revised entry.		

Chart temporarily affected - Aus 66**898(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Browse Island - Drill rig northwestwards**

Former Notice - 646(T)/2015 is cancelled

MODU *ENSCO 5006* (SIRF2015000374), Australian Maritime Safety Authority (SIRF2015000373)Drill rig *ENSCO 5006* is conducting drilling operations in position 13° 50'.81 S 123° 19'.21 E.**Chart temporarily affected - Aus 319 - Aus 320 - AX 00319S - AX 00319U - AX 00320S****899(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - King Sound - Black Rocks - Light altered**

Department of Transport WA Notice 119/2015 (SIRF2015000478)

The light (17° 05'.25 S 123° 35'.41 E) has been altered to *LFl.9s 12m 8M*.**Chart temporarily affected - Aus 45 - Aus 323 - Aus 733****900(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Montebello Islands - Mooring buoys northwestwards**

Date - Until 31 October 2015

Viking Seatech (AA825262), AMSA AUSCOAST 207/15 (SIRF2015000361)

Yellow mooring buoys, *Fl.3s*, exist in the following positions:

19° 55'.86 S 115° 07'.86 E

19° 55'.54 S 115° 07'.74 E.

Chart temporarily affected - Aus 328

901(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - North West Cape - Seismic survey westwards*Date* - Until 30 November 2015

Spectrum Geo Pty Ltd (AA822882)

MV *BGP Explorer*, towing an 8100m cable, and support vessel *Browse Express*, are conducting a survey in the area bounded by the following positions:

22° 37'.00 S 110° 40'.00 E

26° 58'.21 S 110° 25'.86 E

30° 10'.18 S 112° 54'.43 E

29° 47'.57 S 113° 40'.05 E

28° 30'.00 S 114° 19'.10 E

27° 32'.12 S 113° 54'.72 E

25° 25'.07 S 112° 40'.13 E

24° 25'.77 S 112° 40'.11 E

23° 41'.21 S 113° 24'.69 E

22° 37'.00 S 113° 24'.69 E.

Mariners are advised to navigate with caution in the area. 6NM clearance requested.

Chart temporarily affected - Aus 84 - Aus 329 - Aus 331 - Aus 332 - Aus 333 - Aus 745 - Aus 746 - Aus 748 - Aus 749 - Aus 751 - Aus 752

902(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Rankin Bank - Mooring buoys westwards*Date* - Until 31 October 2015

Viking Seatech (SIRF2015000471), AMSA AUSCOAST 211/15 (SIRF2015000443)

12 yellow mooring buoys, *Fl.3s*, exist within 1M radius of position 19° 48'.76 S 115° 17'.82 E.

Chart temporarily affected - Aus 328

903(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Rankin Bank - Drill rig westwards*Former Notice* - 699(T)/2015 is cancelledMODU *Atwood Osprey* (SIRF2015000472), AMSA AUSCOAST 213/15 (SIRF2015000464)

Drill rig *Atwood Osprey* is conducting drilling operations in position 19° 56'.70 S 115° 19'.50 E.

Chart temporarily affected - Aus 328

904(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Rankin Bank - Mooring buoys recovered*Former Notice* - 698(T)/2015 is cancelled

Viking Seatech (SIRF2015000484), AMSA CAN AUSCOAST 146/15 (SIRF2015000107)

Cancel this notice on receipt.

Chart formerly affected - Aus 328

905(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - Port Melbourne - Webb Dock - Light beacons withdrawn*Former Notice* - 1151(T)/2014 is cancelled

Victorian Notice 134/2015 (SIRF2015000179)

Cancel this notice on receipt.

Chart formerly affected - Aus 154

906(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - Port Melbourne - Webb Dock - Harbour works; nav aids; berths

Former Notices - 814(T)/2015, 856(T)/2015 are cancelled

Victorian Notices 134/2015, 142/2015, 143/2015 (SIRF2015000179, SIRF2015000352, SIRF2015000356)

Works are in progress to update the nav aids in the vicinity of Webb Dock.

The following light beacons will be permanently withdrawn and temporarily replaced with light buoys where indicated:

<i>Position</i>	<i>Description</i>	<i>Temporary light buoy</i>
37° 51'.04 S 144° 54'.51 E	<i>Iso.G.4s No23</i>	<i>Fl.G.2-5s</i>
37° 51'.03 S 144° 54'.75 E	<i>Fl.G.5s No81</i>	
37° 51'.03 S 144° 54'.53 E	<i>Fl.R.5s No82</i>	<i>VQ(4)R.4s</i>
37° 50'.98 S 144° 54'.56 E	<i>Fl.R.5s No84</i>	<i>Fl.R.2-5s</i>
37° 50'.85 S 144° 54'.48 E	<i>Iso.R.3s No86</i>	

Light beacons will be installed in the following positions. The piles will be fitted with temporary lights, VQ(4)Y.4s, until permanent lights are installed:

<i>Position</i>	<i>Description</i>
37° 50'.96 S 144° 54'.94 E	<i>F.Bu</i>
37° 50'.90 S 144° 55'.05 E	<i>F.Bu</i>
37° 51'.01 S 144° 54'.98 E	<i>F.Bu</i>
37° 50'.94 S 144° 55'.09 E	<i>F.Bu</i>
37° 51'.06 S 144° 54'.75 E	<i>F.G & Fl.G.5s</i>
37° 50'.97 S 144° 54'.42 E	<i>F.G & Iso.G.4s</i>
37° 50'.98 S 144° 54'.47 E	<i>F.R & Fl.R.5s</i>
37° 50'.89 S 144° 54'.45 E	<i>F.R & Fl.R.5s</i>

The following leading lights have been established:

<i>Position</i>	<i>Description</i>
37° 50'.03 S 144° 54'.06 E	<i>F.Bu.12m 8M</i>
37° 50'.03 S 144° 54'.03 E	<i>F.G.12m 8M</i>
37° 50'.03 S 144° 54'.99 E	<i>F.Bu.12m 8M</i>
37° 50'.36 S 144° 54'.26 E	<i>F.Bu.9m 8M</i>
37° 50'.37 S 144° 54'.23 E	<i>F.G.9m 8M</i>
37° 50'.38 S 144° 54'.20 E	<i>F.Bu.9m 8M</i>

The following lead lights have been withdrawn:

<i>Position</i>	<i>Description</i>
37° 50'.10 S 144° 54'.08 E	<i>F.Bu.12m 8M</i>
37° 50'.37 S 144° 54'.22 E	<i>F.Bu.11m 8M</i>
37° 50'.34 S 144° 54'.19 E	<i>Fl.R.2s 1M</i>

New berths have been declared as follows:

<i>Berth</i>	<i>Position</i>	<i>Maintained depth</i>
Webb Dock West 1	37° 50'.44 S 144° 54'.21 E	12.4m
Webb Dock West 2	37° 50'.56 S 144° 54'.25 E	12.4m
Webb Dock West 3	37° 50'.68 S 144° 54'.34 E	Under Construction

Harbour works are in progress and the berths 3E (37° 50'.60 S 144° 54'.45 E), 4E (37° 50'.73 S 144° 54'.54 E) and 5E (37° 50'.87 S 144° 54'.65 E) are temporarily unavailable for access.

A new edition of Aus 154 will be published shortly.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 154**907(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - South Channel - Harbour Works**

Date - Until 1 December 2015

Port of Melbourne Corporation Notice 151/2015 (SIRF2015000438)

Works associated with the demolition and reconstruction of *Hovell Pile* light (38° 19'.62 S 144° 53'.92 E) are being conducted.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 143 - Aus 158

908(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - The Rip - Survey operations*Date* - Until 24 August 2015

Victorian Notice 145(T)/2015 (SIRF2015000411)

Underwater diving operations are being conducted in The Rip plateau (38° 17'.65 S 144° 38'.00 E).

The works will commence at times of predicted slack water and will work around shipping activities in the entrance to Port Phillip.

Further information can be obtained from Lonsdale VTS or Melbourne VTS on VHF Ch 12.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 143 - Aus 144 - Aus 158**909(T)/2015 AUSTRALIA - BASS STRAIT - Ninety Mile Beach - Inspection works completed***Former Notice* - 503(T)/2015 is cancelled

Transport Safety Victoria Notice 140/2015 (AA825257)

Cancel this notice on receipt.

Chart formerly affected - Aus 357 - Aus 487 - Aus 4644 (INT 644)**910(T)/2015 AUSTRALIA - TASMANIA - Georges Bay - Wreck charted***Former Notice* - 91(T)/2010 is cancelled

MAST (AA824658)

Cancel this notice on receipt.

Chart formerly affected - Aus 169**911(T)/2015 AUSTRALIA - TASMANIA - Macquarie Harbour - Light buoy off station**

MAST M106/15 (SIRF2015000426)

The west cardinal light buoy (42° 17'.70 S 145° 20'.65 E) is off station.

Chart temporarily affected - Aus 177

II

HYDROGRAPHIC REPORTS

NIL

NAVIGATION WARNINGS

The following radio messages have been received during the period to 13 August 2015. Signal copies of these messages may be destroyed. It is recommended that the reprint of Navigational Warnings should be kept in a file or a book divided into areas. Cancellation should be made on receipt of signals and reprints.

Rigs on location other than those listed in the latest Section III summary are the subject of Radio Navigational Warnings. Rigs in transit will not be the subject of Warnings.

AUSCOAST WARNING

- 198 2 x 6m yellow buoys (FL.3s) deployed in the following positions, 19° 55'.31 S 115° 07'.31 E and 19° 55'.19 S 115° 07.27 E. 1M clearance requested.
- 199 Cancelled.
- 200 Cancelled.
- 201 Cancelled.
- 202 Cancelled.
- 203 Cancelled.
- 204 Cancelled.
- 205 Cancelled.
- 206 Cancelled.
- 207 2 x 6m yellow buoys, *Fl.3s*, deployed in the following positions 19° 55'.86 S 115° 07'.86 E and 19° 55'.54 S 115° 07'.74 E. 1M clearance requested.
- 208 Drill Rig Ensco 5006 in position 13° 50'.81 S 123° 19'.20 E.
- 209 Cancelled.
- 210 Drill rig *Atwood Eagle* in position 19° 42'.40 S 115° 52'.52 E.
- 211 12 X 6m yellow buoys, *Fl.3s*, have been deployed within 1M of 19° 48'.76 S 115° 17'.82 E. 2M clearance requested.
- 212 Cancelled.
- 213 Drill Rig *Atwood Osprey* in position 19° 56'.70 S 115° 19'.50 E.
- 214 Reef VTS services degraded – Communications with Reef VTS are possible via VHF only until further notice.
- 215 Flounder A platform light K1890 in position 38° 18'.80 S 148° 26'.30 E is unlit.

NAVAREA X WARNINGS

- 060 Cancelled.
- 061 Warnings in force.

Navigational warnings in force as at 130001UTC AUG 15.**Auscoast**

2015 134 138 155 158 160 163 164 169 171 176 177 178 180 181 189 190 194 207 208 210 211 213 214 215

Navarea X

2015 051 061

Summary of mobile drilling rigs as at 130001UTC AUG 15.

<i>Name</i>	<i>Position</i>
Armada Claire	20° 03'.50 S 115° 11'.50 E
Atwood Eagle	19° 42'.40 S 115° 52'.50 E
Atwood Falcon	21° 31'.70 S 114° 06'.10 E
Atwood Osprey	19° 56'.70 S 115° 19'.50 E
Deepwater Millennium	19° 55'.00 S 115° 05'.40 E
Ensco 5006	13° 50'.80 S 123° 19'.20 E
Jack Bates	13° 49'.50 S 123° 12'.80 E
Modex Venture 11	19° 16'.60 S 116° 36'.70 E
Noble Clyde Boudreaux	13° 49'.00 S 123° 19'.40 E
Ocean Amercia	18° 11'.80 S 116° 51'.30 E
Ocean Monarch	20° 01'.80 S 115° 12'.10 E
Stena Clyde	12° 58'.50 S 124° 29'.20 E
West Telesto	39° 50'.70 S 145° 49'.20 E


NAVAREA XIV WARNINGS

Nil in force

Navarea XIV warnings in force as at 130001UTC AUG 15.

2015

To accompany Australian Notice to Mariners 866/2015

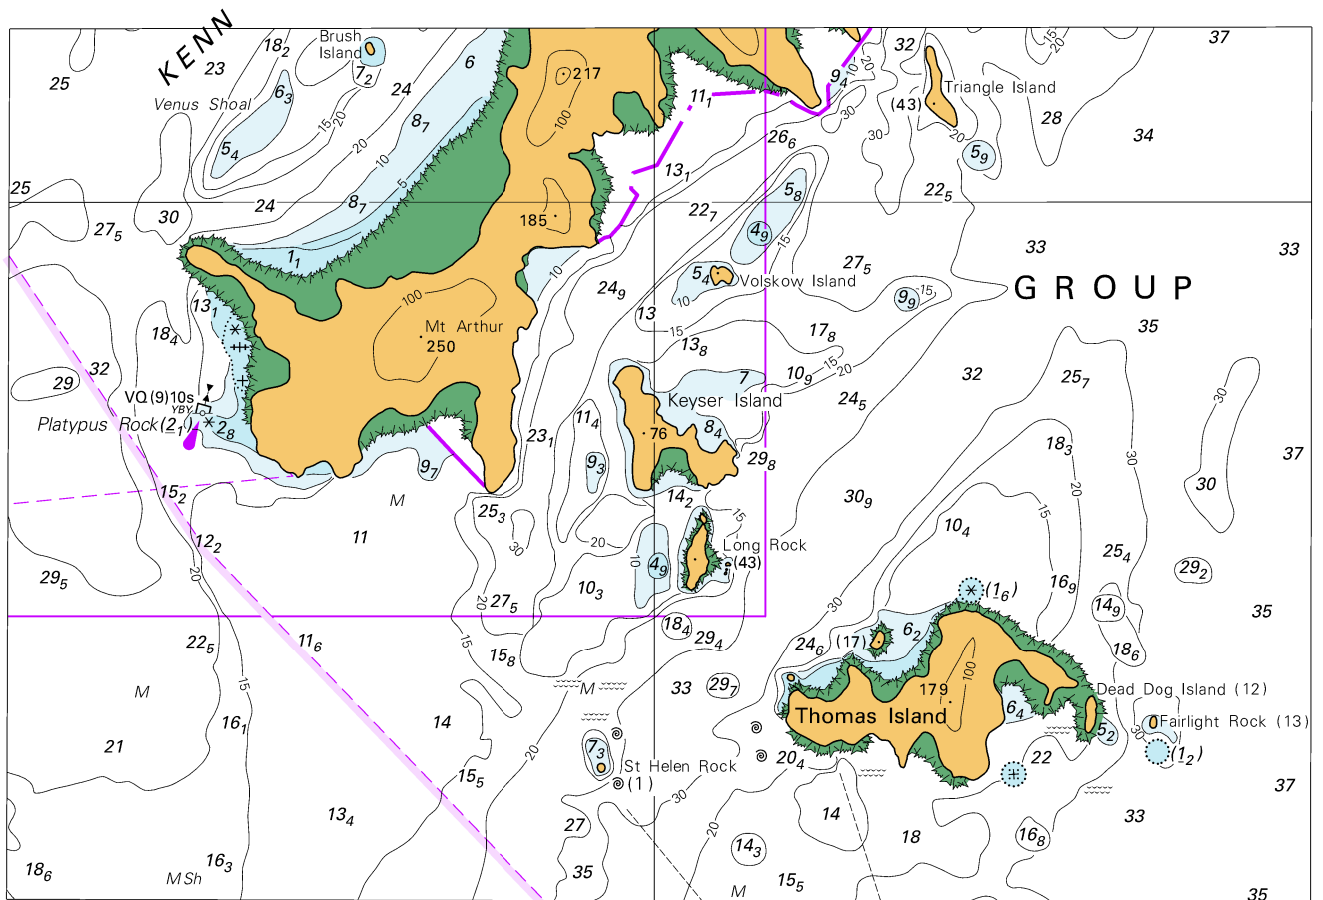

Block for Chart Aus 252

© Commonwealth of Australia 2015

(172.5 x 115.7mm)