



28 August 2015

Edition 17

Australian Notices to Mariners are the authority for correcting Australian Charts and Publications

AUSTRALIAN NOTICES TO MARINERS

Notices 912 - 984



Published fortnightly by the Australian Hydrographic Service

Commodore B.K. BRACE RAN
Hydrographer of Australia

SECTIONS.

- I. **Australian Notices to Mariners, including blocks and notes.**
- II. **Hydrographic Reports.**
- III. **Navigational Warnings.**

SUPPLEMENTS.

- I. **Tracings**
- II. **Cumulative List of Australian Notices to Mariners.**
- III. **Cumulative List of Temporary and Preliminary Australian Notices to Mariners.**
- IV. **Temporary and Preliminary Notices in force.**
- V. **Amendments to Admiralty List of Lights and Fog Signals (Vol K), Radio Signals (NP 281(2), 282, 283(2), 285, 286(4)) and Sailing Directions (NP 9, 13, 14, 15, 33, 34, 35, 36, 39, 44, 51, 60, 61, 62, 100, 136).**

© Commonwealth of Australia 2015

This work is copyright. Apart from any use permitted under the Copyright Act 1968, no part may be reproduced by any process, adapted, communicated or commercially exploited without prior written permission from The Commonwealth represented by the Australian Hydrographic Service.

IMPORTANT NOTICE

This edition of Notices to Mariners includes all significant information affecting AHS products which the AHS has become aware of since the last edition. All reasonable efforts have been made to ensure the accuracy and completeness of the information, including third party information, on which these updates are based. The AHS regards third parties from which it receives information as reliable, however the AHS cannot verify all such information and errors may therefore exist. The AHS does not accept liability for errors in third party information.

GENERAL INSTRUCTIONS

The substance of these notices should be inserted on the charts affected.

Bearings are referred to the true compass and are reckoned clockwise from North; those relating to lights are given as seen by an observer from seaward.

Positions quoted in notices relate to WGS84 which is the horizontal datum for all charts produced by the Australian Hydrographic Service.

The range quoted for a light is its nominal range.

Depths are with reference to the chart datum of each chart. Heights are above mean high water springs or mean higher high water, as appropriate.

The capital letter (P) or (T) after the number of any notice denotes a preliminary or temporary notice respectively, which are contained separately at the end of the permanent notices.

A star (*) adjacent to the number of a notice indicates that the notice is based on original information.

REPORTING OF DANGERS

Mariners are particularly requested to notify the AUSTRALIAN HYDROGRAPHIC SERVICE, Locked Bag 8801 Wollongong, NSW 2500 (Fax 02-4223 6599, e-mail datacentre@hydro.gov.au or, alternatively by filling in and submitting the [Hydrographic Notes](#) forms located on the web site – www.hydro.gov.au), immediately on the discovery of new dangers or suspected dangers to navigation. For changes or defects in aids to navigation notify AusSAR (Fax 02-6230 6868 or email rccaus@amsa.gov.au).

AUTHORISED USE

Copies of Australian notices are available free of charge from the Australian Hydrographic Service (AHS) website (www.hydro.gov.au) and through the eNotices (email) service (www.hydro.gov.au/enotices/enotices.htm).

Individual Notices may be copied for the purpose of inserting Notice substance on official charts and publications. Paper copies may be printed by chart agents and distributed to customers on a cost recovery basis. Participating chart agents are listed on the AHS website as providing a 'Paper Notices to Mariners' service (www.hydro.gov.au/prodserv/distributors/distributors.htm). Copies of the notices may not be sold for profit without prior written agreement.

NUMERICAL INDEX OF NOTICES TO MARINERS

Edition No 17

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
912	Products - New Charts and New Editions to be published shortly
913	Products- New Charts, New Editions, Withdrawn Charts
914	Amendment to Australian Notice to Mariners No 10B
915	Aus 207, 208
916	Aus 200, 201, AX 00200T, 00201T
917	Aus 235
918	Aus 831
919	Aus 539
920	Aus 623
921	Aus 680
922	Aus 646
923	Aus 314, 319, 4721, 4722, INT 721, 722, AX 00314U, 00319S, 00319U, 04721U, 04722U
924	Aus 65, 66
925	Aus 64, 328, 743, 744, 4723, 4725, INT 723, 725, AX 04723U
926	Aus 334, 335, 755, 756, AX 00334S, 00335S, 00755S
927	Aus 63, 327, 743
928	Aus 63, 327, 328, 743
929	Aus 4727, 4728, INT 727, 728
930	Aus 121
931	Aus 143, 157
932	Aus 143, 155
933	Aus 349, 487, 788, 4644, 4728, INT 644, 728, AX 00349S, 00487S
934	Aus 150, 801
935	Aus 169, 171
936	Aus 172
937	Aus 175
938(T)	Aus 222
939(T)	Aus 204, 217, AX 00215T
940(T)	Aus 609, 4601, 4602, INT 601, 602
941(T)	Aus 207, 208, 809, AX 00809S
942(P)	Aus 209
943(T)	Aus 236, 238
944(T)	Aus 242
945(T)	Aus 262, 830, AX 00262T, AXA 0830T
946(T)	Aus 247, 819
947(T)	Aus 249, 251, AX 00249S
948(T)	Aus 244, 245, 246
949(T)	Aus 249, 250, AX 00249S
950(T)	Aus 250
951(T)	Aus 250
952(T)	Aus 249, 823, AX 00249S, 00823S
953(T)	Aus 249, 250, AX 00249S
954(T)	Aus 249, 250, 823, AX 00249S, 00823S
955(T)	Aus 249, 250, 823, 824, AX 00249S, 00823S
956(T)	Aus 235, 236, 237, 238, 814, 815
957(T)	Aus 268
958(T)	Aus 270
959(T)	Aus 235, 236
960(T)	Aus 293, 299
961(T)	Aus 256, 257, 827
962(T)	Aus 256, 257, 827
963(T)	Aus 621, 622
964(T)	Aus 24
965(T)	Aus 28
966(T)	Aus 24, 26, AX 00026T
967(T)	Aus 312, 315, AX 00312U, 00315U
968(T)	Aus 901
969(T)	Aus 328, 329
970(T)	Aus 328
971(T)	Aus 325, 326, 327, 739, 4722, 4723, INT 722, 723, AX 04722U, 04723U
972(T)	Aus 58, 59, 60
973(T)	Aus 319, 4721, 4722, INT 721, 722, AX 00319S, 00319U, 04721U, 04722U
974(T)	Aus 4722, 4723, INT 722, 723, AX 04722U, 04723U
975(T)	Aus 328, 329, 744
976(T)	Aus 328, 329, 744

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
977(T)	Aus 328, 4723, INT 723, AX 04723U
978(T)	Aus 327, 4723, INT 723, AX 04723U
979(T)	Aus 357, 4644, INT 644, AX 00357S
980(T)	Aus 143, 155
981(T)	Aus 154
982(T)	Aus 143, 144, 158
983(T)	Aus 168
984(T)	Aus 173, 795, 796, AX 00795S, 00796S

NUMERICAL INDEX OF CHARTS AFFECTED

Edition No 17

Aus Chart	Notices
Aus 24	964(T), 966(T)
Aus 26	966(T)
Aus 28	965(T)
Aus 58	972(T)
Aus 59	972(T)
Aus 60	972(T)
Aus 63	927, 928
Aus 64	925
Aus 65	924
Aus 66	924
Aus 121	930
Aus 143	931, 932, 980(T), 982(T)
Aus 144	982(T)
Aus 150	934
Aus 154	981(T)
Aus 155	932, 980(T)
Aus 157	931
Aus 158	982(T)
Aus 168	983(T)
Aus 169	935
Aus 171	935
Aus 172	936
Aus 173	984(T)
Aus 175	937
Aus 200	916
Aus 201	916
Aus 204	939(T)
Aus 207	915, 941(T)
Aus 208	915, 941(T)
Aus 209	942(P)
Aus 217	939(T)
Aus 222	938(T)
Aus 235	917, 956(T), 959(T)
Aus 236	943(T), 956(T), 959(T)
Aus 237	956(T)
Aus 238	943(T), 956(T)
Aus 242	944(T)
Aus 244	948(T)
Aus 245	948(T)
Aus 246	948(T)
Aus 247	946(T)
Aus 249	947(T), 949(T), 952(T), 953(T), 954(T), 955(T)
Aus 250	949(T), 950(T), 951(T), 953(T), 954(T), 955(T)
Aus 251	947(T)
Aus 256	961(T), 962(T)
Aus 257	961(T), 962(T)
Aus 262	945(T)
Aus 268	957(T)
Aus 270	958(T)
Aus 293	960(T)
Aus 299	960(T)
Aus 312	967(T)
Aus 314	923
Aus 315	967(T)

Aus Chart	Notices
Aus 319	923, 973(T)
Aus 325	971(T)
Aus 326	971(T)
Aus 327	927, 928, 971(T), 978(T)
Aus 328	925, 928, 969(T), 970(T), 975(T), 976(T), 977(T)
Aus 329	969(T), 975(T), 976(T)
Aus 334	926
Aus 335	926
Aus 349	933
Aus 357	979(T)
Aus 487	933
Aus 539	919
Aus 609	940(T)
Aus 621	963(T)
Aus 622	963(T)
Aus 623	920
Aus 646	922
Aus 680	921
Aus 739	971(T)
Aus 743	925, 927, 928
Aus 744	925, 975(T), 976(T)
Aus 755	926
Aus 756	926
Aus 788	933
Aus 795	984(T)
Aus 796	984(T)
Aus 801	934
Aus 809	941(T)
Aus 814	956(T)
Aus 815	956(T)
Aus 819	946(T)
Aus 823	952(T), 954(T), 955(T)
Aus 824	955(T)
Aus 827	961(T), 962(T)
Aus 830	945(T)
Aus 831	918
Aus 901	968(T)
Aus 4601	940(T)
Aus 4602	940(T)
Aus 4644	933, 979(T)
Aus 4721	923, 973(T)
Aus 4722	923, 971(T), 973(T), 974(T)
Aus 4723	925, 971(T), 974(T), 977(T), 978(T)
Aus 4725	925
Aus 4727	929
Aus 4728	929, 933
AX 00026T	966(T)
AX 00200T	916
AX 00201T	916
AX 00215T	939(T)
AX 00249S	947(T), 949(T), 952(T), 953(T), 954(T), 955(T)
AX 00262T	945(T)
AX 00312U	967(T)
AX 00314U	923

Aus Chart	Notices
AX 00315U	967(T)
AX 00319S	923, 973(T)
AX 00319U	923, 973(T)
AX 00334S	926
AX 00335S	926
AX 00349S	933
AX 00357S	979(T)
AX 00487S	933
AX 00755S	926
AX 00795S	984(T)
AX 00796S	984(T)
AX 00809S	941(T)
AX 00823S	952(T), 954(T), 955(T)
AX 04721U	923, 973(T)
AX 04722U	923, 971(T), 973(T), 974(T)
AX 04723U	925, 971(T), 974(T), 977(T), 978(T)
AXA 0830T	945(T)

INT Chart	Notices
INT 601	940(T)
INT 602	940(T)
INT 644	933, 979(T)
INT 721	923, 973(T)
INT 722	923, 971(T), 973(T), 974(T)
INT 723	925, 971(T), 974(T), 977(T), 978(T)
INT 725	925
INT 727	929
INT 728	929, 933

912 AUSTRALIA - Products - New Charts and New Editions to be published shortly

Australian Hydrographic Service (AA829037)

New Charts to be published shortly

<i>Chart</i>	<i>Title</i>	<i>Scale</i>	<i>Expected Publication Date</i>	<i>Remarks</i>
NIL	NIL			

New Editions to be published shortly

<i>Chart</i>	<i>Title</i>	<i>Scale</i>	<i>Expected Publication Date</i>	<i>Remarks</i>
Aus 835 <i>Edition 5</i>	Australia - East Coast - Queensland - Cape Weymouth to Cairncross Islets	1:150 000	11 September 2015	New edition with general updating throughout.

913 AUSTRALIA - Products- New Charts, New Editions, Withdrawn Charts
Australian Hydrographic Service (DHDB 1488617)

New Charts

Chart	Title and Geographical limits	Scale	Publication Date	Remarks
NIL				

New Electronic Navigation Chart (Aus ENC)

Cell Name	Title	Publication Date	Remarks
AU5643P1	Papua New Guinea - North East Coast - Port of Lae	29 August 2015	AU5XX643 withdrawn

New Editions and Withdrawn Charts

Chart	Title	Scale	Publication Date	Remarks
NIL				

New Miscellaneous Editions

Chart	Title	Scale	Publication Date	Remarks
NIL				

Chart permanently withdrawn

Charts listed above as withdrawn no longer meet chart carriage requirements and should be marked as "superseded" and replaced with the new chart/ new edition listed prior to passage through the area covered by the new chart.

When placing orders with a chart agent between notice of forthcoming edition and its publication, mariners should advise whether their order pertains to the current edition or the new edition.

For further details refer to the AHS website at www.hydro.gov.au for new edition and new chart stock arrival information.

When placing orders with a chart agent, mariners should advise whether their order pertains to the current edition or the new edition.

914 AUSTRALIA - Product - Amendment to Australian Notice to Mariners No 10B
Australian Hydrographic Service (AA783280)

Page 70

Delete	entry for Adele Island racon
	entry for Robe racon
	entry for Fawkner Light Beacon racon
	entry for Prince George Light Beacon racon

915* AUSTRALIA - NEW SOUTH WALES - Newcastle - Light buoys
Port Authority of New South Wales (SIRF2015000423)

Aus 207 [673/2014]

Insert	special spherical light buoy, <i>Fl(5)Y.20s & Fl.2s</i> , without topmark	32° 54'.951 S	151° 48'.540 E
	special spherical light buoy, <i>Fl(5)Y.20s & Fl.2s</i> , without topmark	32° 54'.949 S	151° 48'.743 E
Delete	light buoy	32° 54'.95 S	151° 48'.55 E
	light buoy	32° 54'.95 S	151° 48'.75 E

Aus 208 [628/2013]

Insert	special spherical light buoy, <i>Fl(5)Y.20s & Fl.2s</i> , without topmark	32° 54'.951 S	151° 48'.540 E
Delete	light buoy	32° 54'.95 S	151° 48'.55 E

916* AUSTRALIA - NEW SOUTH WALES - Port Jackson - Quarantine Beach - Light

NSW Roads and Maritime Services (SIRF2015000425, SIRF2015000511)

Aus 200 [861/2015]

Insert	light, <i>Fl. Y. 3s</i>	33° 48'.908 S	151° 17'.134 E
--------	-------------------------	---------------	----------------

Aus 201 [219/2015]

Insert	light, <i>Fl. Y. 3s</i>	33° 48'.908 S	151° 17'.134 E
--------	-------------------------	---------------	----------------

AX 00200T [994/2014]

Insert	light, <i>Fl. Y. 3s</i>	33° 48'.908 S	151° 17'.134 E
--------	-------------------------	---------------	----------------

AX 00201T [219/2015]

Insert	light, <i>Fl. Y. 3s</i>	33° 48'.908 S	151° 17'.134 E
--------	-------------------------	---------------	----------------

917* AUSTRALIA - QUEENSLAND - Mooloolaba - Light beacon*Former Notice - 1104(T)/2013 is cancelled*

Maritime Safety Queensland (SIRF2015000455)

Aus 235 (plan, Mooloolaba Harbour) [575/2015]

Delete	topmark	26° 41'.01 S	153° 08'.12 E
--------	---------	--------------	---------------

918* AUSTRALIA - QUEENSLAND - Trinity Bay - Light buoy

Maritime Safety Queensland Notice 237/2015 (SIRF2015000509)

Aus 831 [774/2015]

Insert	starboard lateral conical light buoy, <i>Fl. G. 3s</i> , without topmark	16° 18'.74 S	145° 27'.04 E
--------	--	--------------	---------------

919* PAPUA NEW GUINEA - Luise Island - Breakwaters; lights

National Maritime Safety Authority PNG (AA818287)

Aus 539 (plan, Luise Harbour) [1300/2010]

Insert	accompanying block	3° 07'.20 S	152° 39'.10 E
--------	--------------------	-------------	---------------

920* PAPUA NEW GUINEA - McFarlane Harbour - Nav aids

National Maritime Safety Authority PNG (SIRF2015000488)

Aus 623 [247/2014]

Delete	beacon	10° 06'.2 S	148° 10'.4 E
	beacon	10° 06'.1 S	148° 10'.3 E
	beacon	10° 06'.0 S	148° 10'.3 E
	beacon	10° 05'.8 S	148° 10'.3 E
	beacon	10° 05'.2 S	148° 10'.4 E
	beacon	10° 05'.0 S	148° 10'.4 E
	beacon	10° 04'.8 S	148° 10'.4 E
	beacon	10° 04'.7 S	148° 10'.5 E
	beacon	10° 04'.4 S	148° 10'.4 E
	beacon	10° 04'.3 S	148° 10'.3 E
	beacon	10° 04'.0 S	148° 11'.1 E
	beacon	10° 04'.0 S	148° 11'.0 E
	beacon	10° 03'.8 S	148° 11'.3 E
	beacon	10° 03'.5 S	148° 11'.5 E
	beacon	10° 05'.6 S	148° 10'.2 E
	beacon	10° 04'.5 S	148° 10'.9 E
	beacon	10° 04'.1 S	148° 10'.3 E
	dashed and continuous line emanating from beacon	10° 04'.5 S	148° 10'.9 E
	dashed and continuous line emanating from beacon	10° 04'.1 S	148° 10'.3 E

921* PAPUA NEW GUINEA - New Britain - Rabaul - Lights, navline
National Maritime Safety Authority PNG (SIRF2015000451)

Aus 680 [823/2015]

Insert	legend, 349·7°	4° 15'.51 S	152° 10'.84 E
Amend	light range to 8M	4° 11'.7 S	152° 10'.1 E
	light range to 9M	4° 11'.9 S	152° 10'.1 E
Delete	recommended track, between	4° 16'.2 S	152° 10'.9 E
		4° 15'.7 S	152° 10'.8 E
	legend, 349·4°	4° 16'.0 S	152° 10'.9 E

Aus 680 (plan, Simpson and Matupit Harbours) [823/2015]

Insert	a dashed line in a direction 169·7° for a distance of 1440m, thence a continuous line for 5960m, with legend 349·7°, emanating from light	4° 11'.710 S	152° 10'.079 E
Amend	light range to 8M	4° 11'.71 S	152° 10'.08 E
	light range to 9M	4° 11'.94 S	152° 10'.12 E
Delete	dashed and continuous line with legend, emanating from light	4° 11'.71 S	152° 10'.08 E
	recommended track, between	4° 15'.66 S	152° 10'.82 E
		4° 16'.10 S	152° 10'.90 E

922* PAPUA NEW GUINEA - Sek Harbour - Depths
Aquamap Pty Ltd (DHDB 2569130)

Aus 646 [612/2015]

Insert	accompanying block	5° 05'.00 S	145° 48'.00 E
--------	--------------------	-------------	---------------

923* AUSTRALIA - TIMOR SEA - Sahul Banks - Wells
Sinopec Oil and Gas Australia Pty Ltd (SIRF2015000287, SIRF2015000555)

Aus 314 [615/2015]

Delete	depth, 76m enclosed by danger circle with legend Well	12° 21'.4 S	124° 17'.3 E
	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
	depth, 97m enclosed by danger circle with legend Well	12° 17'.6 S	124° 20'.3 E

Aus 319 [730/2015]

Delete	depth, 76m enclosed by danger circle with legend Well	12° 21'.4 S	124° 17'.3 E
	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
	depth, 97m enclosed by danger circle with legend Well	12° 17'.6 S	124° 20'.3 E

Aus 4721 (INT 721) [776/2015]

Delete	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
--------	---	-------------	--------------

Aus 4722 (INT 722) [831/2015]

Delete	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
--------	---	-------------	--------------

AX 00314U [615/2015]

Delete	depth, 76m enclosed by danger circle with legend Well	12° 21'.4 S	124° 17'.3 E
	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
	depth, 97m enclosed by danger circle with legend Well	12° 17'.6 S	124° 20'.3 E

AX 00319S [NE 3/7/2015]

Delete	depth, 76m enclosed by danger circle with legend Well	12° 21'.4 S	124° 17'.3 E
	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
	depth, 97m enclosed by danger circle with legend Well	12° 17'.6 S	124° 20'.3 E

AX 00319U [730/2015]

Delete	depth, 76m enclosed by danger circle with legend Well	12° 21'.4 S	124° 17'.3 E
	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
	depth, 97m enclosed by danger circle with legend Well	12° 17'.6 S	124° 20'.3 E

AX 04721U [776/2015]

Delete	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
--------	---	-------------	--------------

AX 04722U [831/2015]

Delete	depth, 73m enclosed by danger circle with legend Well	12° 22'.9 S	124° 16'.5 E
--------	---	-------------	--------------

924* AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Compass Rose
MNA Offshore Limited (AA828084)

Aus 65 [NC 19/6/2015]

Amend	legend to 0°55' E 2015 (3'W)	20° 45'.3 S	115° 25'.0 E
	legend to 0°55' E 2015 (3'W)	20° 46'.2 S	115° 37'.7 E

Aus 66 [617/2015]

Amend	legend to 0°55' E 2015 (3'W)	20° 48'.98 S	115° 28'.75 E
	legend to 0°55' E 2015 (3'W)	20° 48'.88 S	115° 32'.00 E

925* AUSTRALIA - WESTERN AUSTRALIA - Bessieres Island - Light range
 AMSA ATH 35/2015 (SIRF2015000580)

Aus 64 [582/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
Aus 328 [872/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
Aus 743 [726/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
Aus 744 [581/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
Aus 4723 (INT 723) [872/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
Aus 4725 (INT 725) [872/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E
AX 04723U [872/2015] Amend light range to 10M	21° 31'.7 S	114° 45'.8 E

926* AUSTRALIA - WESTERN AUSTRALIA - Busselton - Nav aids
 Department of Transport WA (AA811454)

Aus 334 [732/2015]			
Insert	light, Q.G	33° 37'.72 S	115° 23'.37 E
Delete	light	33° 37'.8 S	115° 23'.2 E
Aus 335 [772/2014]			
Insert	light, Q.G	33° 37'.72 S	115° 23'.37 E
Delete	light	33° 37'.8 S	115° 23'.2 E
Aus 755 [1227/2014]			
Insert	special spar buoy without topmark	33° 38'.70 S	115° 20'.07 E
	light, Q.G.3M	33° 37'.72 S	115° 23'.37 E
Substitute	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.5 S	115° 20'.8 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.8 S	115° 19'.5 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 38'.2 S	115° 18'.1 E
	port lateral cylindrical light buoy, <i>Q.R</i> , without topmark for light buoy	33° 37'.6 S	115° 22'.8 E
Delete	light	33° 37'.8 S	115° 23'.2 E
Aus 756 [1227/2014]			
Insert	special spar buoy without topmark	33° 38'.70 S	115° 20'.07 E
Substitute	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.5 S	115° 20'.8 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.8 S	115° 19'.5 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 38'.2 S	115° 18'.1 E
AX 00334S [732/2015]			
Insert	light, Q.G	33° 37'.72 S	115° 23'.37 E
Delete	light	33° 37'.8 S	115° 23'.2 E
AX 00335S [NE 3/7/2015]			
Insert	light, Q.G	33° 37'.72 S	115° 23'.37 E
Delete	light	33° 37'.8 S	115° 23'.2 E
AX 00755S [1227/2014]			
Insert	special spar buoy without topmark	33° 38'.70 S	115° 20'.07 E
	light, Q.G.3M	33° 37'.72 S	115° 23'.37 E
Substitute	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.5 S	115° 20'.8 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 37'.8 S	115° 19'.5 E
	special spar light buoy, <i>Fl.Y.3s</i> , without topmark for buoy	33° 38'.2 S	115° 18'.1 E
	port lateral cylindrical light buoy, <i>Q.R</i> , without topmark for light buoy	33° 37'.6 S	115° 22'.8 E
Delete	light	33° 37'.8 S	115° 23'.2 E

927* AUSTRALIA - WESTERN AUSTRALIA - Great Sandy Island - Light range
 AMSA ATH 36/2015 (SIRF2015000581)

Aus 63 [NE 1/11/2013]			
Amend	light range to 11M	21° 11'.9 S	115° 38'.3 E
Aus 327 [831/2015]			
Amend	light range to 11M	21° 11'.9 S	115° 38'.3 E
Aus 743 [925/2015]			
Amend	light range to 11M	21° 11'.9 S	115° 38'.3 E

928* AUSTRALIA - WESTERN AUSTRALIA - Mary Anne Island - Light range
 AMSA ATH 37/2015 (SIRF2015000582)

Aus 63 [927/2015]			
Amend	light range to 11M	21° 15'.7 S	115° 27'.8 E
Aus 327 [927/2015]			
Amend	light range to 11M	21° 15'.7 S	115° 27'.8 E
Aus 328 [925/2015]			
Amend	light range to 11M	21° 15'.7 S	115° 27'.8 E
Aus 743 [927/2015]			
Amend	light range to 11M	21° 15'.7 S	115° 27'.8 E

929* AUSTRALIA - SOUTH AUSTRALIA - Kangaroo Island - Depths
 UKHO (AA808314, AA828201)

Aus 4727 (INT 727) [568/2014]			
Insert	depth, 96m enclosed by contour	35° 14'.5 S	135° 14'.0 E
	depth, 90m enclosed by contour	35° 24'.9 S	135° 09'.4 E
	magenta legend, <i>Adjoining Chart INT 728 (AUS 4728)</i> , in E border	37° 00'.0 S	136° 55'.6 E
Delete	depth, 77m enclosed by danger circle	35° 25'.2 S	135° 54'.5 E
Aus 4728 (INT 728) [280/2015]			
Delete	depth, 77m enclosed by danger circle with legend Rep (1978)	35° 25'.2 S	135° 54'.5 E

930* AUSTRALIA - SOUTH AUSTRALIA - Streaky Bay - Nav aids
 Department for Transport, Energy and Infrastructure SA (AA500634)

Aus 121 (plan, Streaky Bay) [531/2015]			
Insert	beacon	32° 32'.10 S	134° 12'.80 E
	beacon with port lateral topmark	32° 34'.38 S	134° 09'.89 E
Move	beacon	32° 31'.62 S	134° 07'.87 E
	to	32° 31'.65 S	134° 07'.83 E
Delete	topmark	32° 31'.8 S	134° 12'.9 E
	topmark	32° 38'.1 S	134° 14'.8 E
	legend R	32° 31'.8 S	134° 12'.9 E
	beacon	32° 32'.1 S	134° 12'.8 E
	beacon	32° 34'.4 S	134° 09'.9 E
	legend G	32° 38'.1 S	134° 14'.8 E
Aus 121 (plan, Blanche Port) [531/2015]			
Insert	light, <i>Fl.3s 2M</i>	32° 45'.32 S	134° 11'.86 E
Delete	legend G	32° 44'.84 S	134° 13'.71 E

931* AUSTRALIA - VICTORIA - Port Phillip - Prince George Bank - Racon discontinued; AIS
 Port of Melbourne Corporation Notice 158/2015 (SIRF2015000543, SIRF2015000576)

Aus 143 [735/2015]			
Substitute	legend <i>AIS</i> , for legend Racon (G)	38° 06'.4 S	144° 44'.2 E
Aus 157 [781/2015]			
Substitute	legend <i>AIS</i> , for legend Racon (G)	38° 06'.40 S	144° 44'.20 E

932* AUSTRALIA - VICTORIA - Port Phillip - Port Melbourne Channel - Racon discontinued; AIS
 Port of Melbourne Corporation Notice 158/2015 (SIRF2015000578)

Aus 143 [931/2015]

Insert	magenta circle with legend A/S	38° 00'.00 S	144° 55'.66 E
Delete	magenta circle with legend Racon (F)	37° 56'.9 S	144° 55'.6 E

Aus 155 [736/2015]

Insert	magenta circle with legend A/S	38° 00'.00 S	144° 55'.66 E
Delete	magenta circle with legend Racon (F)	37° 56'.92 S	144° 55'.63 E

933* AUSTRALIA - VICTORIA - Split Point - Light range
 AMSA ATH 34/2015 (SIRF2015000583, SIRF2015000606)

Aus 349 [230/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

Aus 487 [836/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

Aus 788 [230/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

Aus 4644 (INT 644) [1263/2013]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

Aus 4728 (INT 728) [929/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

AX 00349S [NE 3/7/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

AX 00487S [836/2015]

Amend	light range to 20/14M	38° 28'.1 S	144° 06'.3 E
-------	-----------------------	-------------	--------------

934* AUSTRALIA - VICTORIA - Western Port - Phillip Island - Pyramid Rock - Light buoy southwards
 Victorian Notice 148/15 (SIRF2015000457)

Aus 150 [673/2015]

Delete	light buoy	38° 34'.6 S	145° 12'.7 E
--------	------------	-------------	--------------

Aus 801 [176/2015]

Delete	light buoy	38° 34'.6 S	145° 12'.7 E
--------	------------	-------------	--------------

935* AUSTRALIA - TASMANIA - Norfolk Bay - Denison Canal - Signal station, navlines
 MAST (SIRF2015000465)

Aus 169 (plan, Blackman Bay) [877/2015]

Insert	traffic signal station	42° 53'.541 S	147° 48'.188 E
	traffic signal station	42° 53'.405 S	147° 48'.402 E
Delete	dashed and continuous line, with legend, emanating from beacon	42° 53'.57 S	147° 48'.15 E
	dashed and continuous line, with legend, emanating from beacon	42° 53'.39 S	147° 48'.46 E
	light	42° 53'.57 S	147° 48'.15 E
	light	42° 53'.39 S	147° 48'.46 E

Aus 171 [624/2015]

Insert	traffic signal station	42° 53'.54 S	147° 48'.19 E
	traffic signal station	42° 53'.41 S	147° 48'.40 E
Delete	dashed and continuous line, with legend, emanating from beacon	42° 53'.6 S	147° 48'.2 E
	dashed and continuous line, with legend, emanating from beacon	42° 53'.4 S	147° 48'.5 E
	light	42° 53'.6 S	147° 48'.2 E
	light	42° 53'.4 S	147° 48'.5 E

936* AUSTRALIA - TASMANIA - River Derwent - Light
 Tasports (SIRF2015000590)

Aus 172 [782/2015]

Amend	legend to <i>F.Bu</i>	42° 51'.59 S	147° 21'.10 E
Delete	light sectors, and leading line, emanating from light	42° 51'.59 S	147° 21'.10 E
	dashed and continuous line with legend Dir 135°, emanating from light	42° 51'.59 S	147° 21'.10 E

937* AUSTRALIA - TASMANIA - Spring Bay - Lights; coastline
 Australian Hydrographic Service (AA300205, AA300203)

Aus 175 [238/2015]

Insert	accompanying block	42° 32'.60 S	147° 55'.00 E
Move	light	42° 31'.212 S	147° 55'.043 E
	to	42° 31'.199 S	147° 55'.050 E
Delete	continuous line, between	42° 31'.21 S	147° 55'.04 E
		42° 31'.20 S	147° 55'.05 E

938(T)/2015 AUSTRALIA - NEW SOUTH WALES - Clarence River - North Channel - Light buoy restored*Former Notice* - 239(T)/2015 is cancelled

Port of Clarence River (Yamba) Notice 005(T)/2015 (AA800310)

Cancel this notice on receipt.

Chart formerly affected - Aus 222**939(T)/2015 AUSTRALIA - NEW SOUTH WALES - Hawkesbury River - Mullet Creek - Light buoy***Former Notice* - 779(T)/2014 is cancelled*Date* - Until 30 July 2016

Hornsby Shire Council (SIRF2015000714)

A special cylindrical light buoy, *Fl. Y. 5s*, exists in position 33° 31'.65 S 151° 14'.16 E.**Chart temporarily affected - Aus 204 - Aus 217 - AX 00215T****940(T)/2015 AUSTRALIA - TASMAN SEA - New Caledonia Basin - Seismic survey**

Gardline Marine Sciences Pty Ltd (SIRF2015000599)

Survey vessel *L'Atalante*, will be conducting a survey in the area bounded by the following positions:

22° 20'.00 S 166° 20'.00 E

37° 30'.00 S 171° 30'.00 E

37° 00'.00 S 163° 30'.00 E

34° 00'.00 S 163° 00'.00 E

25° 00'.00 S 164° 00'.00 E.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 609 - Aus 4601 (INT 601) - Aus 4602 (INT 602)

941(T)/2015 AUSTRALIA - NEW SOUTH WALES - Newcastle - Depth information

Former Notice - 883(T)/2015 is cancelled

Newcastle Port Corporation (SIRF2015000607)

Available depths as at 20 August 2015:

<i>Berth</i>	<i>Metres</i>	<i>Remarks</i>
Eastern Basin 1	11.5	
Eastern Basin 2 North of Ch 450	11.6	
Eastern Basin 2 South of Ch 450	11.6	
Western Basin 3	11.6	
Western Basin 4	11.5	
Channel Berth	9.6	
Dyke 1	12.8	
Dyke 2	12.8	
Dyke 4	16.3	
Dyke 5	16.2	
Dyke 6	5.3	
Mayfield 4 Ch 27 to 266	12.8	
BHP Wharf 6 to Ch 1050	7.3	
Kooragang 2	11.6	
Kooragang 2 North Dolphin Ch 182 to 243	11.6	
Kooragang 2 South Dolphin Ch -92 to 00	11.6	
Kooragang 3 Ch -40 to 00	13.2	
Kooragang 3 Ch 00 to 190	13.4	
Kooragang 3 Ch 190 to 220	13.2	
Kooragang 4	16.5	
Kooragang 5	16.5	
Kooragang 6	16.5	
Kooragang 7	16.3	
Kooragang 8	16.2	
Kooragang 9	16.2	
Kooragang 10	16.3	
Throsby 1 Ch 850 to 1030	8.9	
Carrington Wharf		To be sounded as and when required
Foreshore Park Berth	5.9	
Elgo Wharf		To be sounded as and when required
<i>Channels</i>		
* Entrance Approach	17.5	
Entrance Channel (18.0m)	17.7	
Entrance Channel (17.4m)	17.4	
Entrance Channel (16.8m)	16.8	
Entrance Channel (16.2m)	16.2	
Entrance Channel to Horseshoe	15.2	
Horseshoe	15.2	
Steelworks Channel to Swinging Basin	15.2	
Swinging Basin	15.2	
Hunter River South Arm (Kooragang 6 to buoy 16)	15.2	
Hunter River South Arm (buoy 16 to buoy 20)	15.1	
Basin Cutting	12.6	
Basin Area to Eastern & Western Basin Berths	12.7	
Basin Area to Throsby 1	9.2	
Stockton Crossing	3.6	
* Indicates new or revised entry.		

Chart temporarily affected - Aus 207 - Aus 208 - Aus 809 - AX 00809S**942(P)/2015 AUSTRALIA - NEW SOUTH WALES - Port Stephens - Boondelbah Island - Rock**

NSW Roads and Maritime Services (SIRF2015000566)

An dangerous underwater rock exists in position 32° 42'.50 S 152° 13'.54 E.

Chart will be updated on receipt of bathymetric survey data.

Chart which will be affected - Aus 209

943(T)/2015 AUSTRALIA - QUEENSLAND - Brisbane River - Hamilton Reach to South Brisbane Reach - Harbour works completed

Former Notice - 131(T)/2015 is cancelled
Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 236 - Aus 238

944(T)/2015 AUSTRALIA - QUEENSLAND - Bundaberg - Burnett River - Harbour works completed

Former Notice - 484(T)/2015 is cancelled
Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 242

945(T)/2015 AUSTRALIA - QUEENSLAND - Cairns - Dredging operations

Date - Until 24 September 2015
Maritime Safety Queensland Notice 250(T)/2015 (SIRF2015000713)

The dredge *Brisbane* is conducting dredging operations in the Entrance Channel (16° 52'.3 S 145° 48'.5 E).

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 262 - Aus 830 - AX 00262T - AXA 0830T

946(T)/2015 AUSTRALIA - QUEENSLAND - Fitzroy River - Scientific instrument

Date - Until 31 October 2015
Maritime Safety Queensland Notice 231(T)/2015 (SIRF2015000323)

A special purpose buoy exists in position 23° 30'.20 S 150° 45'.32 E.

Chart temporarily affected - Aus 247 - Aus 819

947(T)/2015 AUSTRALIA - QUEENSLAND - Freshwater Point to Keswick Island - Scientific instruments

Maritime Safety Queensland Notices 253(T)/2015 (SIRF2015000709)

Scientific instruments marked by special light buoys, *Fl.4s*, exist in positions 21° 24'.98 S 149° 20'.21 E and 20° 55'.67 S 149° 25'.31 E.

Chart temporarily affected - Aus 249 - Aus 251 - AX 00249S

948(T)/2015 AUSTRALIA - QUEENSLAND - Gladstone - Drilling operations completed

Former Notice - 183(T)/2015 is cancelled
Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 244 - Aus 245 - Aus 246

949(T)/2015 AUSTRALIA - QUEENSLAND - Hay Point - Light restored

Former Notice - 186(T)/2015 is cancelled
Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 249 - Aus 250 - AX 00249S

950(T)/2015 AUSTRALIA - QUEENSLAND - Hay Point - Diving operations completed

Former Notice - 541(T)/2015 is cancelled
Maritime Safety Queensland (AA807257)

Cancel this notice on receipt.

Chart formerly affected - Aus 250

951(T)/2015 AUSTRALIA - QUEENSLAND - Hay Point - Scientific instrument

Date - Until 15 December 2015
Maritime Safety Queensland Notices 254(T)/2015 (SIRF2015000704)

Scientific instrument marked by special light buoy, *Fl.4s*, exists in position 21° 15'.84 S 149° 18'.11 E.

Chart temporarily affected - Aus 250

952(T)/2015 AUSTRALIA - QUEENSLAND - Hay Point - Racon discontinued

Former Notice - 636(T)/2014 is cancelled
Maritime Safety Queensland Notice 169/2015 (AA829253)

Cancel this notice on receipt.

Chart formerly affected - Aus 249 - Aus 823 - AX 00249S - AX 00823S

953(T)/2015 AUSTRALIA - QUEENSLAND - Hay Point - Scientific instrument

Former Notice - 133(T)/2015 is cancelled
Maritime Safety Queensland Notices 254(T)/2015 (SIRF2015000704)

Cancel this notice on receipt.

Chart formerly affected - Aus 249 - Aus 250 - AX 00249S

954(T)/2015 AUSTRALIA - QUEENSLAND - Mackay - Round Top Island to Slade Point - Scientific instruments

Maritime Safety Queensland Notice 420(T)/2014 (AA757024)

Scientific instruments marked by special light buoys, *Fl.4s*, exist in the following positions:

21° 05'.60 S 149° 14'.59 E

21° 10'.10 S 149° 15'.72 E

21° 10'.69 S 149° 18'.07 E.

Chart temporarily affected - Aus 249 - Aus 250 - Aus 823 - AX 00249S - AX 00823S

955(T)/2015 AUSTRALIA - QUEENSLAND - Mackay - Round Top Island to Slade Point - Scientific instruments recovered

Former Notice - 737(T)/2014 is cancelled
Maritime Safety Queensland Notice 255(T)/2015 (SIRF2015000708)

Cancel this notice on receipt.

Chart formerly affected - Aus 249 - Aus 250 - Aus 823 - Aus 824 - AX 00249S - AX 00823S

956(T)/2015 AUSTRALIA - QUEENSLAND - Moreton Bay - Brisbane River - Depth information

Former Notice - 886(T)/2015 is cancelled

Brisbane Port Corporation (SIRF2015000625)

Available depths and under keel clearances (UKC) at 20 August 2015:

<i>Berth</i>	<i>Metres</i>	<i>Remarks</i>
* Fisherman Islands No12	13.5	
* Fisherman Islands No11	14.1	
Fisherman Islands No10	13.8	
Fisherman Islands No9	13.9	
Fisherman Islands No8	14.2	
Fisherman Islands No7	14.1	
Fisherman Islands No6	14.1	
Fisherman Islands No5	14.0	
Fisherman Islands No4	13.9	
* Fisherman Islands No3	13.9	
Fisherman Islands No2	14.0	
Fisherman Islands No1	14.1	
* Fisherman Islands Grain and Woodchip	13.1	
Caltex Fisherman Islands	14.3	
* Fisherman Islands Coal	14.2	
* Fisherman Islands General Purpose	11.2	
* BP Luggage Point	13.8	
Caltex Products	10.3	
Cement Australia Co Wharf	9.5	
* BP Products	10.8	
Viva Energy	10.9	
Graincorp Liquid Terminal	10.7	
Incitec North	10.0	
Incitec South	10.4	
* Pinkenba 1	10.4	
* Pinkenba 2	10.4	
Riverside Marina	-	
Sugar Terminal	9.9	
Cairncross Fitting Out Wharf	7.1	
Cairncross Breasting Wharf	4.4	
Brisbane Naval Wharf	4.3	
Maritime No1	8.6	
Hamilton No4	10.1	
Hamilton No1	8.8	
* Brisbane Cruise Ship Terminal	8.8	
	<i>Metres</i>	<i>UKC/Remarks</i>
<i>Moreton Bay:</i>		
North West Channel	15.0	2.3 (280m width)
North West Bypass Channel	9.2	1.6
Spitfire Channel	15.0	1.5 (600m width)
East Knoll Bypass Channel	6.0	1.4
East Channel	15.0	1.5 (300m width from western side)
Main Channel (M8 - M9)	10.0	1.8
Entrance Channel (E5 - EBCN)	14.7	1.5
<i>Brisbane River:</i>		
Outer Bar Cutting	14.0	1.46
Inner Bar Cutting	14.0	1.46
Fisherman Islands Swing Basin	14.0	1.3
Fisherman Islands Swing Basin (11.5)	11.5	0.6
River	9.1	0.6 / 0.9 (draft/tide)
Cement Australia Swing Basin	9.1	0.6 / 0.9 (draft/tide)
Pinkenba Swing Basin	9.1	0.6 / 0.9 (draft/tide)
* Hamilton Swing Basin	8.7	0.6 / 0.9 (draft/tide)
* Indicates new or revised entry.		

Chart temporarily affected - Aus 235 - Aus 236 - Aus 237 - Aus 238 - Aus 814 - Aus 815

957(T)/2015 AUSTRALIA - QUEENSLAND - Port Denison - Light buoy restored

Former Notice - 1237(T)/2014 is cancelled
 Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 268**958(T)/2015 AUSTRALIA - QUEENSLAND - Port Douglas - Depth information**

Former Notice - 1274(T)/2012 is cancelled
 Maritime Safety Queensland Notice 241(T)/2015 (SIRF2015000574)

Available depths as at 18 August 2015:

	<i>Metres</i>
* Outer Channel	2.2
* Inner Channel	2.4
* Boat ramp to marina	2.3
*Indicates revised entry.	

Chart temporarily affected - Aus 270**959(T)/2015 AUSTRALIA - QUEENSLAND - Pumicestone Channel - Light beacon unlit**

Maritime Safety Queensland Notice 246(T)/2015 (SIRF2015000658)

The light beacon, *Fl.G.2.5s* (27° 02'.90 S 153° 07'.85 E) is unlit.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 235 - Aus 236**960(T)/2015 AUSTRALIA - QUEENSLAND - Thursday Island - Lights restored**

Former Notice - 1188(T)/2014 is cancelled
 Maritime Safety Queensland (AA828441)

Cancel this notice on receipt.

Chart formerly affected - Aus 293 - Aus 299**961(T)/2015 AUSTRALIA - QUEENSLAND - Townsville - Dredging operations completed**

Former Notice - 845(T)/2015 is cancelled
 Maritime Safety Queensland Notices 243(T)/2015 (SIRF2015000587)

Cancel this notice on receipt.

Chart formerly affected - Aus 256 - Aus 257 - Aus 827

962(T)/2015 AUSTRALIA - QUEENSLAND - Townsville - Depth information*Former Notice - 844(T)/2015 is cancelled*

Maritime Safety Queensland Notice 244(T)/2015 (SIRF2015000659)

Available depths as at 20 August 2015:

	<i>Metres</i>	<i>Remarks</i>
Sea Channel	11.8	
Platypus Channel	11.7	
<i>Outer Harbour:</i>		
Arrival Channel	6.0	
Departure Channel	9.3	
<i>Inner Harbour:</i>		
Harbour	11.1	
<i>Berths:</i>		
No 1	12.4	
No 2	12.5	
No 3	12.0	
No 4	10.9	
No 7	-	Demolition in progress.
No 8	12.9	
No 9	11.4	
Between No 9 and No 10	8.3	Seaward of 0 mark at No 10
No 10	11.7	
* No 11	10.9	
Ross River Channel	2.2	Entrance to beacon No 6
Ross River	-	Upstream of beacon No 6
Ross Creek	-	
* Indicates new or revised entry.		

Chart temporarily affected - Aus 256 - Aus 257 - Aus 827**963(T)/2015 PAPUA NEW GUINEA - Port Moresby - Fairfax Harbour - Survey Operations***Date - Until 30 September 2015*

National Maritime Safety Authority PNG Notice 25(T)/2015 (SIRF2015000524)

Survey operations are being conducted in Fairfax Harbour, (9° 26'.0 S 147° 06'.0 E).

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 621 - Aus 622**964(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - Sadgroves Creek - Light beacon restored***Former Notice - 550(T)/2015 is cancelled*

Darwin Port Corporation Notice 103(T)/2015 (SIRF2015000608)

Cancel this notice on receipt.

Chart formerly affected - Aus 24**965(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - East Arm - Bladin Point - Tide gauges***Date - Until 30 September 2015*

Northern Territory Government Notice 104(T)/2015 (SIRF2015000609)

Tide gauges, marked by special light buoys, Q.Y, exist in the following positions:

12° 30'.37 S 130° 55'.12 E

12° 30'.36 S 130° 55'.15 E.

Chart temporarily affected - Aus 28

966(T)/2015 AUSTRALIA - NORTHERN TERRITORY - Darwin - Dredging*Date* - Until 30 September 2015

Northern Territory Government Notice 109(T)/2015 (SIRF2015000724)

Dredging operations are in progress in Darwin Naval Base, 12° 27'.67 S 130° 49'.37 E.

A floating pipeline marked by special buoys, Q. Y, exists.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 24 - Aus 26 - AX 00026T**967(T)/2015 AUSTRALIA - TIMOR SEA - Sahul Banks - Mooring buoys; seismic survey southeastwards***Former Notice* - 896(T)/2015 is cancelled*Date* - Until 30 November 2015

ConocoPhillips Australia (SIRF2015000375, SIRF2015000377, SIRF2015000435, SIRF2015000560), AMSA AUSCOAST 228/15 (SIRF2015000634)

Mooring buoys have been withdrawn from the following positions:

11° 05'.33 S 126° 39'.83 E

11° 05'.30 S 126° 36'.80 E.

Lit yellow mooring buoys, F. Y, exist as follows:

11° 03'.90 S 126° 52'.30 E

11° 05'.25 S 126° 52'.30 E.

MV *Ramform Sovereign* with a 5500m towed array, and support vessels *Unlimited* and *Thor Alpha* will be conducting a survey from 10 September 2015 in the area bounded by the following positions:

10° 50'.00 S 126° 27'.00 E

11° 17'.00 S 126° 27'.00 E

11° 17'.00 S 126° 52'.00 E

10° 50'.00 S 126° 52'.00 E.

Mariners are advised to navigate with caution. 4M clearance requested.

Chart temporarily affected - Aus 312 - Aus 315 - AX 00312U - AX 00315U**968(T)/2015 EAST TIMOR - Dili Bay - Obstruction**

HMAS Huon (SIRF2015000697)

An above water obstruction exists in position 8° 33'.02 S 125° 34'.37 E.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 901**969(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Mooring buoys recovered***Former Notice* - 688(T)/2015 is cancelled

Viking Seatech (SIRF2015000523), AMSA CAN AUSCOAST 134/2015 (SIRF2015000525)

Cancel this notice on receipt.

Chart formerly affected - Aus 328 - Aus 329

970(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Scientific instruments northwestwards

Former Notice - 849(T)/2015 is cancelled
 MetOcean Engineers (SIRF2015000588)

Scientific instruments exist as follows:

<i>Position</i>	<i>Remarks</i>
19° 47'.21 S 114° 34'.76 E	subsurface
19° 47'.17 S 114° 36'.00 E	orange spherical light buoy, Q(5)Y.20s
20° 25'.04 S 114° 56'.00 E	special pillar light buoy, Q(5)Y.20s
20° 24'.77 S 114° 55'.69 E	orange spherical light buoy, Q(5)Y.20s
20° 26'.17 S 114° 55'.20 E	subsurface

Chart temporarily affected - Aus 328

971(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Bedout Island - Seismic survey northwestwards

Former Notice - 596(T)/2015 is cancelled
Date - Until 30 November 2015
 Polarcus DMCC (SIRF2015000646)

Survey vessel *Polarcus Naila*, with a 10000m towed array and support vessels *Pacific Protector* and *Empress*, are conducting a survey in the area bounded by the following positions:

18° 38'.89 S 116° 50'.93 E
 18° 38'.93 S 117° 48'.47 E
 19° 13'.27 S 118° 04'.77 E
 19° 12'.44 S 119° 20'.90 E
 18° 41'.77 S 119° 20'.47 E
 18° 13'.09 S 119° 08'.62 E
 17° 21'.98 S 118° 18'.79 E
 17° 13'.03 S 117° 56'.53 E
 17° 12'.95 S 117° 00'.32 E
 17° 22'.37 S 116° 50'.99 E.

Mariners are advised to navigate with caution in the area. 7NM clearance requested.

Chart temporarily affected - Aus 325 - Aus 326 - Aus 327 - Aus 739 - Aus 4722 (INT 722) - Aus 4723 (INT 723) - AX 04722U - AX 04723U

972(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Dampier - Rio Tinto Channel - Dredging operations completed

Former Notice - 257(T)/2015 is cancelled
 Pilbara Ports Authority (SIRF2015000669)

Cancel this notice on receipt.

Chart formerly affected - Aus 58 - Aus 59 - Aus 60

973(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Eugene McDermott Shoal - Drill rig northwestwards

Former Notice - 756(T)/2015 is cancelled
Date - Until 4 September 2015
 MODU *Stena Clyde* (SIRF2015000517), AMSA (SIRF2015000519)

MODU *Stena Clyde* is conducting drilling operations in position 12° 57'.60 S 124° 27'.64 E.

Chart temporarily affected - Aus 319 - Aus 4721 (INT 721) - Aus 4722 (INT 722) - AX 00319S - AX 00319U - AX 04721U - AX 04722U

974(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Glomar Shoal - Drill rig moved

Former Notice - 758(T)/2015 is cancelled
 MODU *Ocean America* (SIRF2015000639), AMSA (SIRF2015000638)

Cancel this notice on receipt.

Chart formerly affected - Aus 4722 (INT 722) - Aus 4723 (INT 723) - AX 04722U - AX 04723U

975(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Muiron Islands - Mooring buoys northwestwards*Former Notice* - 760(T)/2015 is cancelled*Date* - Until 15 October 2015

BHP Billiton Petroleum Pty Ltd (SIRF2015000636), AMSA AUSCOAST 227/15 (SIRF2015000633)

Lit mooring buoys exist in the following positions:

<i>Position</i>	<i>Remarks</i>
21° 31'.55 S 114° 07'.61 E	<i>Fl.5s</i>
21° 31'.43 S 114° 07'.29 E	<i>Fl.5s</i>
21° 31'.14 S 114° 07'.23 E	<i>Fl.5s</i>

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 328 - Aus 329 - Aus 744**976(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Muiron Islands - Drill rig northwestwards***Former Notice* - 759(T)/2015 is cancelled*Date* - Until 15 October 2015MODU *Atwood Falcon* (SIRF2015000725)Drill rig *Atwood Falcon* is conducting drilling operations in position 21° 31'.74 S 114° 06'.06 E.**Chart temporarily affected - Aus 328 - Aus 329 - Aus 744****977(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - North West Cape - Drill rig moved northwestwards***Former Notice* - 802(T)/2015 is cancelledMODU *Deepwater Millennium* (SIRF2015000720)

Cancel this notice on receipt.

Chart formerly affected - Aus 328 - Aus 4723 (INT 723) - AX 04723U**978(T)/2015 AUSTRALIA - WESTERN AUSTRALIA - Rankin Bank - Drill rig northeastwards***Former Notice* - 805(T)/2015 is cancelled*Date* - Until 2 October 2015MODU *Atwood Eagle* (SIRF2015000561)Drill rig *Atwood Eagle* is conducting drilling operations in position 19° 42'.40 S 115° 52'.55 E.**Chart temporarily affected - Aus 327 - Aus 4723 (INT 723) - AX 04723U****979(T)/2015 AUSTRALIA - VICTORIA - Ninety Mile Beach - Drill rig moved***Former Notice* - 854(T)/2015 is cancelledMODU *West Telesto* (SIRF2015000719)

Cancel this notice on receipt.

Chart formerly affected - Aus 357 - Aus 4644 (INT 644) - AX 00357S**980(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - St Kilda - Harbour works completed***Former Notice* - 323(T)/2015 is cancelled

Victorian Notice 155(T)/2015 (SIRF2015000518)

Cancel this notice on receipt.

Chart formerly affected - Aus 143 - Aus 155

981(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - Port Melbourne - Webb Dock - Harbour works*Date* - Until 31 August 2016

Port of Melbourne Corporation notice 159(T)/2015 (SIRF2015000564)

Demolition works are in progress at Webb Dock bounded by a silt curtain marked by special light buoys, Q.Y, between the following positions:

37° 50'.63 S 144° 54'.28 E

37° 50'.66 S 144° 54'.33 E

37° 50'.75 S 144° 54'.38 E

37° 50'.90 S 144° 54'.43 E.

A west cardinal light buoy, VQ(9)10s, has been established in position 37° 50'.70 S 144° 54'.50 E.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 154

982(T)/2015 AUSTRALIA - VICTORIA - Port Phillip - The Rip - Survey operations*Former Notice* - 908(T)/2015 is cancelled*Date* - Until 30 September 2015

Victorian Notice 168(T)/2015 (SIRF2015000745)

Underwater diving operations are being conducted on The Rip plateau (38° 17'.65 S 144° 38'.00 E).

The works will commence at times of predicted slack water and will work around shipping activities in the entrance to Port Phillip.

Further information can be obtained from Lonsdale VTS or Melbourne VTS on VHF Ch 12.

Mariners are advised to navigate with caution in the area.

Chart temporarily affected - Aus 143 - Aus 144 - Aus 158

983(T)/2015 AUSTRALIA - TASMANIA - River Tamar - Kings Wharf - Dredging operations completed*Former Notice* - 564(T)/2015 is cancelled

MAST (SIRF2015000541)

Cancel this notice on receipt.

Chart formerly affected - Aus 168

984(T)/2015 AUSTRALIA - TASMANIA - Trumpeter Bay - Marine farm; light buoys*Date* - Until 16 October 2015

Marine and Safety Tasmania Notice 107/2015 (SIRF2015000494)

Works associated with the installation of a marine farm are in progress. The boundary will be marked by cardinal buoys in the following positions:

43° 09'.88 S 147° 25'.93 E West Cardinal

43° 10'.62 S 147° 26'.17 E West Cardinal

43° 09'.77 S 147° 26'.58 E East Cardinal

43° 10'.51 S 147° 26'.82 E East Cardinal

Chart temporarily affected - Aus 173 - Aus 795 - Aus 796 - AX 00795S - AX 00796S

HYDROGRAPHIC REPORTS

<i>Locality</i>	<i>Report</i>	<i>Ship/Authority</i>	<i>Observer</i>
EAST TIMOR- Dili Bay	Obstruction	<i>HMAS Huon</i>	J O'Brien
SA- Point Souttar	Depths and light beacon	<i>SV Starwave</i>	M Sinclair
SA- Wardang Island	Depths	<i>SV Starwave</i>	M Sinclair

NAVIGATION WARNINGS

The following radio messages have been received during the period to 27 August 2015. Signal copies of these messages may be destroyed. It is recommended that the reprint of Navigational Warnings should be kept in a file or a book divided into areas. Cancellation should be made on receipt of signals and reprints.

Rigs on location other than those listed in the latest Section III summary are the subject of Radio Navigational Warnings. Rigs in transit will not be the subject of Warnings.

AUSCOAST WARNING

216 Cancelled.
 217 Cancelled.
 218 Cancelled.
 219 Cancelled.
 220 Drill rig *Stena Clyde* in position 12° 57'.60 S 124° 27'.63 E.
 221 Special purpose vessel *Joides Resolution* conducting drilling operations in position 20° 12'.80 S 115° 04'.00 E. 2M clearance requested.
 222 Cancelled.
 223 Cancelled.
 224 Cancelled.
 225 Cancelled.
 226 Cancelled.
 227 3 yellow buoys, *Fl.5s*, deployed within 1M of 21° 31'.40 S 114° 07'.20 E.
 228 2 X 3m yellow buoys, *Fl(2).Y.10s*, deployed in positions 11° 03'.90 S 126° 52'.30 E and 11° 05'.25 S 126° 52'.30 E. 1M clearance requested.
 229 Pelsaert Island light K1753.6 in position 28° 59'.13 S 113° 57'.74 E nominal range changed to 15M.
 230 Drill rig *Deepwater Millennium* in position 20° 02'.97 S 116° 37'.75 E.
 231 Cancelled.

NAVAREA X WARNINGS

062 Cancelled.
 063 Warnings in force.

Navigational warnings in force as at 270001UTC AUG 15.

Auscoast

2015 138 155 158 163 176 177 178 180 181 190 194 207 208 210 211 213 220 221 227 228 229 230

Navarea X

2015 051 063

Summary of mobile drilling rigs as at 270001UTC AUG 15.

Name	Position
Armada Claire	20° 03'.50 S 115° 11'.50 E
Atwood Eagle	19° 42'.40 S 115° 52'.50 E
Atwood Falcon	21° 31'.70 S 114° 06'.10 E
Atwood Osprey	19° 56'.70 S 115° 19'.50 E
Deepwater Millennium	20° 03'.00 S 116° 37'.80 E
Ensco 5006	13° 50'.80 S 123° 19'.20 E
Jack Bates	13° 49'.50 S 123° 12'.80 E
Modec Venture 11	19° 16'.60 S 116° 36'.70 E
Noble Clyde Boudreaux	13° 49'.00 S 123° 19'.40 E
Ocean Amercia	18° 11'.80 S 116° 51'.30 E
Ocean Monarch	20° 01'.80 S 115° 12'.10 E
Stena Clyde	12° 57'.60 S 124° 27'.60 E
West Telesto	39° 50'.70 S 145° 49'.20 E

NAVAREA XIV WARNINGS


Nil in force

28 August 2015

Navarea XIV warnings in force as at 270001UTC AUG 15.


2015

To accompany Australian Notice to Mariners 919/2015

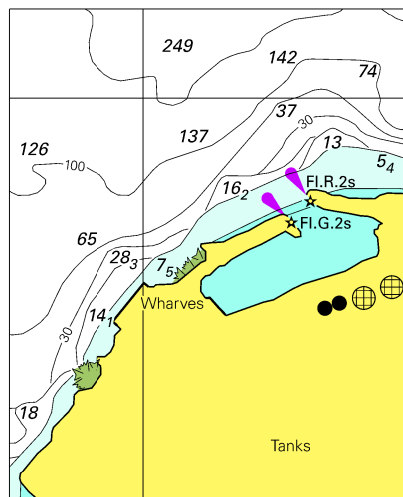

© Commonwealth of Australia 2015
Block for Chart Aus 539 (53.3 X 64.8mm)

To accompany Australian Notice to Mariners 922/2015

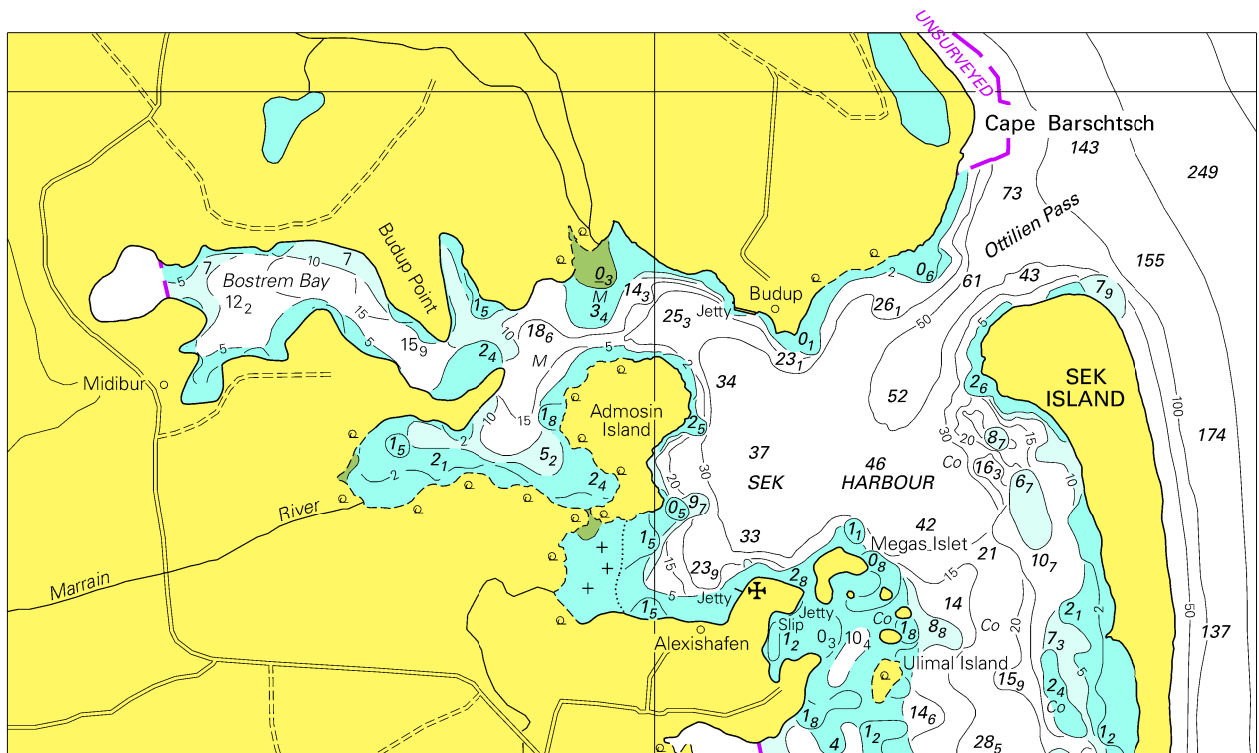


Block for Chart Aus 646

© Commonwealth of Australia 2015

(165.2 X 95.3mm)

To accompany Australian Notice to Mariners 937/2015

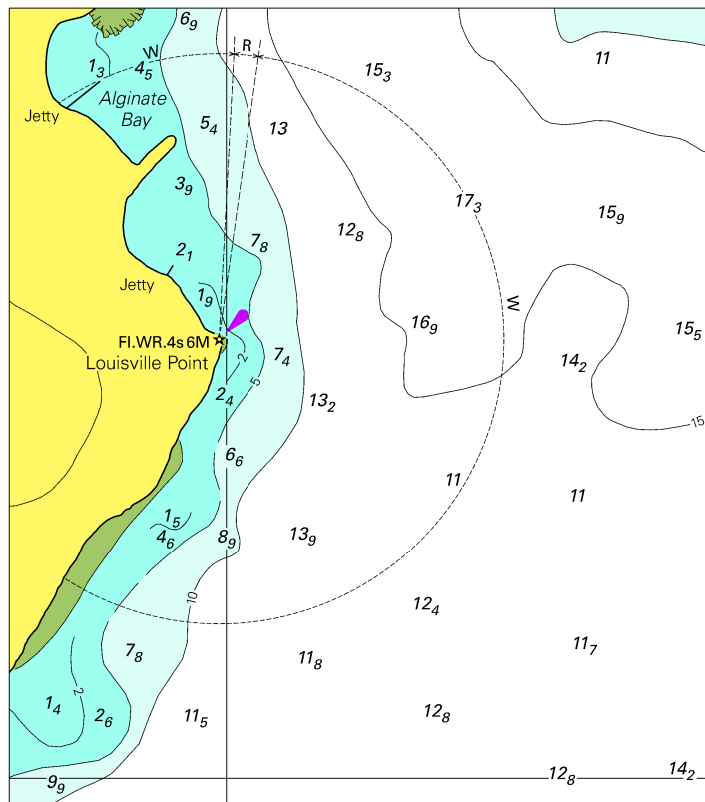

© Commonwealth of Australia 2015

Block for Chart Aus 175

(93.1 X 105.5mm)